

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO.
30-025-12788

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement
Name:

HOBBS

8. Well No.

E-15

9. Pool name or Wildcat
SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☐ Other SWD Well

2. Name of Operator

RICE OPERATING COMPANY

3. Address of Operator

122 W. TAYLOR, HOBBS, NM 88240

4. Well Location

Unit Letter E : 1650 feet from the NORTH line and 840 feet from the WEST line

Section 15 Township 19S Range 38E NMPM LEA County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3611' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST / CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

PLUG AND ABANDON PURSUANT TO NM UIC LETTER 12-01-99:

Procedure Attached: Start Date 01-23-02. Completion of P&A 02-06-02.

P&A of this SWD Well E-15 denotes discontinuance of operation of the Hobbs SWD System. The Facility Site at the E-15 location will be abandoned in accordance with the approved Generic Closure Plan for Below-Grade Redwood Tanks and Emergency Overflow Pits submitted to NMOCED Environmental Bureau (Contact Wayne Price) in Santa Fe. The closure plan is targeted to begin in December, 2002.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carolyn Doran Haynes TITLE ENGINEERING MANAGER DATE 3-8-02

Type or print name CAROLYN DORAN HAYNES

Telephone No. 505-393-9174

(This space for State use)

APPROVED BY GARY W. WINK TITLE _____ DATE _____

Conditions of approval, if any:

GARY W. WINK

OG FIELD REPRESENTATIVE II/STAFF MANAGER

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

JAN 30 2003

HOBBS SWD WELL E-15 Plugged and Abandoned

1650' FNL & 840' FWL, Sec 15, T19S, R38E, Lea County, New Mexico

DF Elevation is 3611'

API No. 30-025-12788

SWD Order No. SWD- R-1004

Dry Hole Marker is Installed

12 1/4" hole

SURFACE PLUG 60'

Perforate @ 60' squeeze 30 SXS

Casing cement level @ surface

9 5/8" 32.3# Csg @ 322' w/275 sx

Cmt Circ to Surface

SURFACE CSG SHOE PLUG 143' FROM 229-372'

Perforate @ 372' and squeeze 50 SXS

TOC @ 1200'

T/Anhydrite 1605'

30 SXS PLUG 153' FROM 1500-1653'

T/Salt 1700'

Tight spot in casing at 2233' and 2248'

8 3/4" hole

30 SXS PLUG 150' @ 2604-2754'

T/Grayburg 4078'

T/San Andres 4141'

DV TOOL @

4315'

Tag Cement plug @ 4161'

Tag Gravel @ 4406'

Tag TD @ 4717'

TD 4872'


4634-4644'

4660-4700'

4728-4773'

4802-4826'

7" 20# Csg @ 4872' w/1175 sx

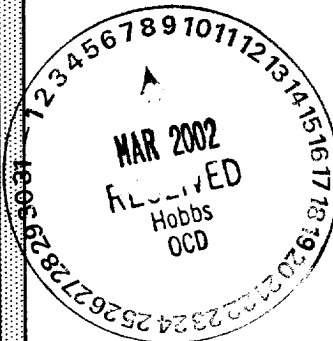

	10# Gel Mud
	New Cement Plugs
	Cement Behind Casing
	Gravel
	Fill

50 SXS PLUG 245' @ 4161-4406'

Drawn	BY
11/15/00	CDH
4/9/01	CDH
3/4/02	CDH

RICE OPERATING COMPANY
122 West Taylor
Hobbs, New Mexico 88240

P & A Hobbs SWD E-15
1650' FNL & 840' FWL
SEC 15, T19S, R38E
Lea County New Mexico

MAYO MARRS CASING PULLING INC.

RICE OPERATING COMPANY

ATTN: CAROLYN HAYNES

FAX 505-397-1471

Lease: HOBBS SWD WELL "E" # 15

Project: P & A

01-23-02

NOTIFY OCD – MOVE IN RIG UP –

1-29-02

WORK 5 ½" CASING LOOSE – LAY DOWN 31 JOINTS – CLOSE IN WELL

1-30-02

LAY DOWN 107 JOINTS 5 ½" CASING – BEGIN RUNNING IN HOLE WITH CIBP
CLOSE IN WELL

1-31-02

RIH WITH CIBP – HIT COLLAPSED CASING @ 2233' - POOH – RIH & KNOCK
PLUG THRU TIGHT SPOT @ 2233' & ANOTHER TIGHT SPOT @ 2248' WITH
DRILL COLLARS -POOH
(3 HRS RIG)

2-01-02

RIH & HIT TIGHT SPOT @ 2233' WITH CIBP GAUGE RING – POOH – RIH OPEN
ENDED & SPOT 15 SXS CEMENT @ 4534' – POOH – WOC – CLOSE IN WELL
(9 HRS RIG)

2-04-02


RIH & GET NO TAG – TAG TD @ 4717' – POOH & SPOT 15 SXS CEMENT @
4534' – POOH – WOC – DUMP 3 YARDS GRAVEL – RIH & TAG GRAVEL @
4406' – SPOT 50 SXS CEMENT @ 4406' – POOH – CLOSE IN WELL
(8 HRS RIG)

2-05-02

RIH & TAG @ 4161' – CIRCULATE 10# MUD – POOH & SPOT 30 SXS @ 2754'
2604' (OCD ADDED PLUG) – POOH & SPOT 30 SXS @ 1653' - 1500' POOH – RIH
& PERFORATE @ 372' – SQUEEZE 50 SXS – CLOSE IN WELL
(1 HR RIG)

2-06-02

RIH & TAG @ 229' – RIH & PERFORATE @ 60' PER NEW MEXICO OCD –
SQUEEZE 30 SXS TO SURFACE ON ANNULUS LEAVING CASING FULL – RIG
DOWN – INSTALL DRY HOLE MARKER – MOVE OUT

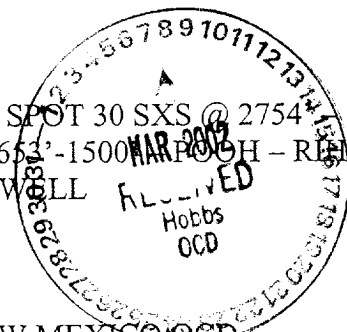

MAYO MARRS CASING PULLING INC.
BOX 863
KERMIT, TEXAS 79745

RICE OPERATING COMPANY

Lease: HOBBS – E # 15

Project: P & A – CEMENTING REPORT

02-01-2002 – SPOT 15 SXS @ 4534' – 4717' TAGGED
02-04-2002 – SPOT 65 SXS @ 4534' - 4161' TAGGED
02-05-2002 - SPOT 30 SXS @ 2754' - 2604'
02-05-2002 - SPOT 30 SXS @ 1653' - 1500'
02-05-2002 - PERFORATED @ 372'
02-05-2002 - SQUEEZE 50 SXS @ 372' – 229' TAGGED
02-06-2002 - PERFORATED @ 60' – SQUEEZED CEMENT TO SURFACE
LEAVING ANNULUS AND CASING FULL

INSTALL DRY HOLE MARKER
CIRCULATE 10# MUD

