

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

811 South First, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO. 30-025-20217
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: L. Van Etten
8. Well No. 11
9. Pool name or Wildcat Eumont, Yates 7 Rvrs Queen

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Texaco Exploration & Production, Inc.

3. Address of Operator
P. O. Box 3109, Midland, TX 79702

4. Well Location
Unit Letter I : 1980 feet from the South line and 660 feet from the East line
Section 9 Township 20S Range 37E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- RIH w/WS Tag TOC on CIBP @ +/- 5100'. Spot 25 Sx plug 5100'-4900' (Glorietta Paddock) WOC Tag.
- Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
- Spot 25 Sx plug 3400'-3200' (Queen)
- Perf 6 holes @ 2600' Sqz 50 Sx plug 2600'-2400' (Yates, B-Salt) WOC Tag.
- Perf 6 holes @ 1300', Sqz 100 Sx plug 1300'-1000' (8 5/8" shoe, T-Salt) WOC Tag.
- 10 Sx Surf, Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James T. Corbitt TITLE FACILITY ENGINEER DATE 10/16/01
Type or print name JAMES T. CORBITT Telephone No. 688-4438
(This space for State use)

APPROVED BY _____ TITLE _____ DATE _____
Conditions of approval, if any:

MP

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR TEXACO Exploration & Production

LEASENAME L. VAN ETTEN

WELL # 11

SECT 9 TWN 20S RNG 37E


FROM 1980 NSL 660 EWL

TD: 6880

FORMATION @ TD Deinkard

PBTD:

FORMATION @ PBTD Glorieta

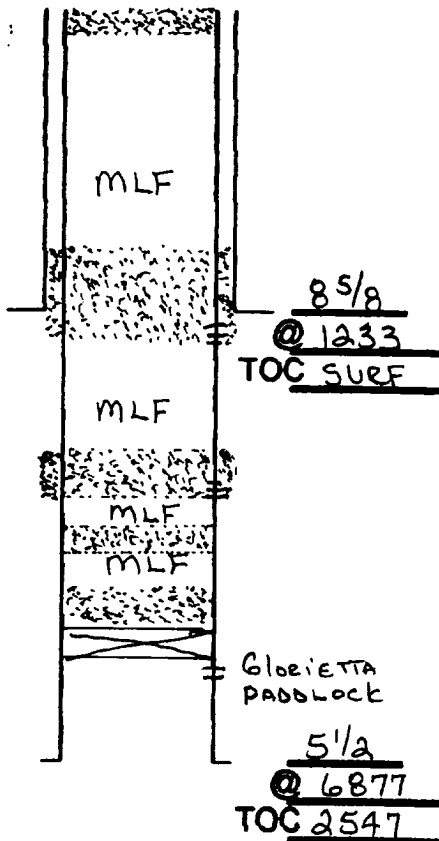

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	8 5/8	1233	SURF	CIRC
INTMED 1				
INTMED 2				
PROD	5 1/2	6877	2547	CALC
	SIZE	TOP	BOT	TOC DETERMINED BY
LINER 1				
LINER 2				
	CUT & PULL @		TOP - BOTTOM	
INTMED 1			PERFS	5223 - 5257
INTMED 2			OPENHOLE	-
PROD				

*REQUIRED PLUGS DISTRICT I

RUTLER (AMTID)	
YATES	
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPTAN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BILNEY CANYON	
BONE SPRING	
GLORIETA	
ELMERRY	
TUBB	
DEBKARD	
ABO	
WC	
PERK	
STRAWN	
ATOKA	
MCCROW	
AME	
DEVONIAN	

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLES			
PLUG #1	OH	35 SXS	6400'
PLUG #2	SHOE	50 SXS	5350'-5450'
PLUG #3	CIBP/35'		4800'
PLUG #4	CIBP	25 SXS	4800'
PLUG #5	STUB	50 SXS	3600'-3700'
PLUG #6	RETNR SQZ	200 SXS	400'
PLUG #7	SURF	10 SXS	0-10'
PLUG #1	Glorieta	25 SX	5100-4900
PLUG #2	QUEEN	25 SX	3400-3200
PLUG #3	YATES	50 SX	2600-2400
PLUG #4	8 5/8 S	100 SX	1300-1000
PLUG #5	SURF	10 SX	10'-SURF
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #1			
PLUG #2			
PLUG #3			
PLUG #4			
PLUG #5			
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			

TD 6880