
MINIMUM CHOKE MANIFOLD 3,000, 5,000 and 10,000 PSI Working Pressure

Coyote State Well No. 1 SE/4 NW/4, Sec. 36, T19S, R35E Lea County, New Mexico

3 MWP - 5 MWP - 10 MWP

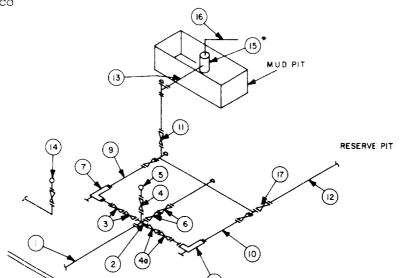

*Location of separator optional

BEYO	NI D	CHE	CT	DII	$\sim T$	110	_
BETU	Nυ	206	331	Rυ	U I	υĸ	c

	MINIMUM REQUIREMENTS										
_		1	3,000 MWP		5,000 MWP			10,000 MWP			
No.		I.D.	NOMINAL	RATING	1.D.	NOMINAL	RATING	.D.	NOMINAL	RATING	
1	Line from drilling spool		3″	3,000		3"	5,000		3"	10,000	
2	Cross 3"x3"x3"x2"			3,000			5,000				
_	Cross 3"x3"x3"x3"									10,000	
3	Valves(1) Gate □ Plug □(2)	3-1/8"		3,000	3-1/8"		5,000	3-1/8"		10,000	
4	Valve Gate ☐ Plug ☐(2)	1-13/16"		3,000	1-13/16"		5,000	1-13/16"		10,000	
4a	Valves(1)	2-1/16"		3,000	2-1/16"		5,000	3-1/8"		10,000	
5	Pressure Gauge	Ī		3,000			5,000			10,000	
6	Valves Gate □ Plug □(2)	3-1/8"		3,000	3-1/8"		5,000	3-1/8"		10,000	
7	Adjustable Choke(3)	2"		3,000	2"		5,000	2"		10,000	
8	Adjustable Choke	1"		3,000	1"		5,000	2"		10,000	
9	Line		3″	3,000		3″	5,000		3″	10,000	
10	Line		2"	3,000		2"	5,000		3″	10,000	
11	Valves Gate (2)	3-1/8"		3,000	3-1/8"		5,000	3-1/8"		10,000	
12	Lines		3″	1,000		3"	1,000		3″	2,000	
13	Lines		3"	1,000		3"	1,000	·	3″	2,000	
14	Remote reading compound standpipe pressure gauge			3,000			5,000			10,000	
15	Gas Separator		2'x5'			2'x5'			2'x5'		
16	Line		4"	1,000		4"	1,000		4"	2,000	
17	Valves Gate C Plug (2)	3-1/8"		3,000	3-1/8"		5,000	3-1/8"		10,000	

- (1) Only one required in Class 3M.
- (2) Gate valves only shall be used for Class 10M.
- (3) Remote operated hydraulic choke required on 5,000 psi and 10,000 psi for drilling.

EQUIPMENT SPECIFICATIONS AND INSTALLATION INSTRUCTIONS

- 1. All connections in choke manifold shall be welded, studded, flanged or Cameron clamp of comparable rating.
- 2. All flanges shall be API 6B or 6BX and ring gaskets shall be API RX or BX. Use only BX for 10 MWP.
- 3. All lines shall be securely anchored.
- 4. Chokes shall be equipped with tungsten carbide seats and needles, and replacements shall be available.
- 5. Choke manifold pressure and standpipe pressure gauges shall be available at the choke manifold to assist in regulating chokes. As an alternate with automatic chokes, a choke manifold pressure gauge shall be located on the rig floor in conjunction with the standpipe pressure gauge.
- 6. Line from drilling spool to choke manifold should be as straight as possible. Lines downstream from chokes **shall** make turns by large bends or 90° bends using bull plugged tees.
- 7. Discharge lines from chokes, choke bypass and from top of gas separator should vent as far as practical from the well.