

DISTRICT I
PO Box 1980, Hobbs, NM 88241-1980
DISTRICT II
PO Drawer DD, Artesia, NM 88211-0719
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

PO Box 2088
Santa Fe, NM 87504-2088

WELL API NO.	30-025-34364
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	23178
7. Lease Name or Unit Agreement Name	INDIANA "1"
8. Well No.	1
9. Pool name or Wildcat	Goodwin, Abo 23179

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
SAHARA OPERATING COMPANY

3. Address of Operator
P.O. Box 4130, Midland, Texas 79704

4. Well Location
Unit Letter G : 1682 Feet From The North Line and 1975 Feet From The East Line
Section 1 Township 19 South Range 36 East NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3751' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

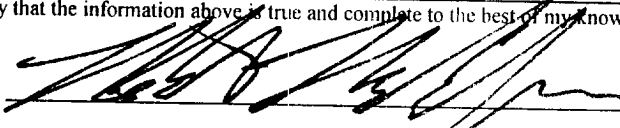
SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103

8/19/99 RU Freemeyer and acidize dn tbg w/750 gals 15% HCL acid w/36 balls. Balled out. Surge off balls, finish trtmnt. Swab back load.
8/20/99 Kill well w/2% KCL. POH w/tbg & pkr. RU WL & set RBP @ 7455' Dmp 1 sk snd on top. TIH w/tbg OE.
8/23/99 Spot 300 gals 15% HCL on btm. POH w/tbg. RU WL & perf 7276-7582', 7284-88, 7292-95, 7297-7302', 7307-12', 7315-22', 7326-30', 7336-42', 7353-60', 7369-73', 7378-90', 7404-12', 7429-41', 7446-47'. SDON.
8/24/99 TIH w/pkr & tbg. Set pkr @ 7177', swab dn, RU Freemeyer & Az w/500 gals 15% HCL. Swab back load, SDON.
8/25/99 RU Freemeyer & Az w/5000 gals 15% HCL & 175 balls. Swab back load.
8/26/99 SITP 520#. Flwd well dn. Unset pkr, TIH, washed sand & balls off RBP, caught RBP & POH. LD Tools, TIH w/MA, PS, SN TAC & 115 stds tbg. ND BOP, NU WH, RIH w/GA & 2.5 x 1.5 x 20' RWBC pmp on 112-3/4", 85-7/8", 82-1" rods. Started well pumping. Rig down & release pulling unit.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE President DATE 3-15-99
TYPE OR PRINT NAME Robert McAlpine TELEPHONE NO 1-915-697-0967

(This space for State Use)

APPROVED BY ORIGINAL SIGNED BY: JERRY WILLIAMS TITLE DISTRICT SUPERVISOR DATE SEP 2 1999

CONDITIONS OF APPROVAL, IF ANY:

IC

1

