

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Co. Division
P.O. Box 1980
Hobbs, NM 88241

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

LC-031736(t) NM-62667

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Amoco Production Company

3. Address and Telephone No. Attn: T G Tullos, m/c 17.166 (281) 366-7337

P O Box 4891, Houston, TX 77210

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Letter A, 390 FNL x 660 FEL, Sec 21, T-20-S, R-37-E

7. If Unit or CA, Agreement Designation

8. Well Name and No

Gillully B Federal

9. API Well No RA A #6Y

30-025-06201

10. Field and Pool, or Exploratory Area

Eumont

11. County or Parish, State

Lea, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION


- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other reactivate previously producing zone

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

See attached description of operations

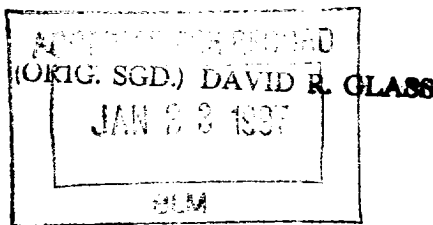

RECEIVED
JAN 16 9 45 AM '97

14. I hereby certify that the foregoing is true and correct

Signed Tom G. Tullos

Title Sr. Business Analyst

Date 1/08/97

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____

Gillully B Federal RA A #6Y

From: 12/10/96 07:00:00 **To:** 12/10/96 18:00:00 **11.00 Hrs** **PLANNED** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 1 FISHING

Operations Description: Rig Up
MIRU X WORK ON TBG HEAD X UNABLE TO PU ON TBG X SION.

From: 12/11/96 07:00:00 **To:** 12/11/96 18:00:00 **11.00 Hrs** **UNPLANNED TROUBLE** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 1 FISHING

Operations Description: Fishing
SPEAR TBG X REMOVE OLD TBG BHEAD X INST RECONDITION 6" X 600 SCREW ON TBG HEAD. LATCH
ON TBG X OS X TBG STUCK. RUN FREE POINT X TBG 100% STUCK 2675' X 100% FREE X 2650'. CUT
TBG OFF X 2660'. LD 85 JTS 2 3/8 H-40 TBG.

From: 12/12/96 07:00:00 **To:** 12/12/96 18:00:00 **11.00 Hrs** **UNPLANNED TROUBLE** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 1 FISHING

Operations Description: Fishing
R 4 3/4 SHOE X 1 JT 4.5 WP X JARS X 6-3 1/2 DC'S X PU WORKSTRING TO 2645 X PMP 63 BBLs
WATER X BROKE CIRC. WASH OVER TOP OF FISH 2660 TO 2746 X DID NOT HAVE ANY FILL. CIRC
HOLE CLEAN X PU ABOVE TOP OF FISH X SION.

From: 12/13/96 07:00:00 **To:** 12/13/96 18:00:00 **11.00 Hrs** **UNPLANNED TROUBLE** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 1 FISHING

Operations Description: Fishing
TOH X TBG X DC'S X TOOLS. R 4 11/16 OS X TBG X LATCH ON FISH X 2660'. UNABLE TO REL OUT
OF PKR. FREE POINT TBG X CUT TBG OFF 3550'. TOH X REC X LD 28 JTS TBG. TIH X OS X LATCH
ON FISH X 3550'. JAR MANDRAL OUT OF PKR. TOH X REC FISH. R BIT X CSG SCRAPER.

From: 12/16/96 07:00:00 **To:** 12/16/96 18:00:00 **11.00 Hrs** **PLANNED** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 1 FISHING

Operations Description: Tripping
VERBLE APPROVAL FROM VINCE BALDERAZ (BLM) TO SET CIBP ABOVE PKR X 3575. FIN RTG X TAG
TOP OF PKR X 3575' X TOH. R CIBP X SA 3574 X CAP X 35' OF CMT X TIH X TBG X SION.

From: 12/17/96 07:00:00 **To:** 12/17/96 18:00:00 **11.00 Hrs** **PLANNED** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 5 REMOVED/RUN

Operations Description: Rig Down
FIN RTG X LD WORKSTRING X R SEATING NIPPLE X PU X RUN 83 JTS NEW 2 3/8 TBG. TLA 2622
X ND BOP X NU WELL HEAD X RDMOSU.

From: 12/18/96 07:00:00 **To:** 12/18/96 18:00:00 **11.00 Hrs** **PLANNED** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 4 TESTING/SWABBING

Operations Description: Swabbing
TPC 200 PSI X CPC 200 PSI. BLOW DN TO SLIGHT BLOW. RUN SWB EVERY HR FOR 8 HRS X NO FL
REC.

From: 12/19/96 07:00:00 **To:** 12/19/96 11:00:00 **4.00 Hrs** **PLANNED** **on DURING**

Functional Responsibility: OTHER **Job Sequence No:** 4 TESTING/SWABBING

Operations Description: Swabbing
TPC 210 PSI X CPC 210 PSI. SWB EVERY HR FOR 5 HRS X NO FL REC X SD X RD SWB UNIT.