

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-06281
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Chevron USA, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd., Midland, Texas 79704		7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
4. Well Location Unit Letter <u>H</u> : 1980 feet from the <u>North</u> line and <u>660</u> feet from the <u>East</u> line Section <u>30</u> Township <u>20S</u> Range <u>37E</u> NMPM Lea County		8. Well No. 113
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Eunice Monument Grayburg SA

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒	REMEDIAL WORK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐
OTHER: ☐	OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24 hrs prior to MI & RU.
2. Set CIBP @ 3640', spot 40 Sx plug 3640'-3440' (San Andres) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
4. Spot 40 Sx plug 3400'-3200' (Queen)
5. Cut 6 5/8" Csg @ 2600', L/D Csg.
6. Spot 75 Sx plug 2650'-2450' (8 5/8" Shoe, Stub, B-Salt) WOC Tag.
7. Spot 50 Sx plug 1100'-1000' (T-Salt) WOC Tag.
8. Perf 4 holes @ 251', Sqz 75 Sx plug 251'-150' (12 1/2" Shoe) WOC Tag.
9. 10 Sx Surface, Install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe

TITLE HES Specialist

DATE 5/22/2002

Type or print name G.R. Bledsoe
(This space for State use)

Telephone No. 915.687.7153

APPROVED BY
Conditions of approval, if any:

ORIGINAL SIGNED BY
TITLE

OC FIELD REPRESENTATIVE II/STAFF MANAGER


DATE

MAY 23 2002

PLUGGING & ABANDONMENT WORKSHEET

OPERATOR CHEVRON USA
 LEASE NAME EUNICE MONUMENT SOUTH UNIT
 WELL # 113

SECT 30 TWN 20 S RNG 37 E
 FROM 1980 NSL 660 EWL
 TD 3918 FORMATION @ TD GRAYBURG
 PBDT FORMATION @ PBDT SAN-ANDRES

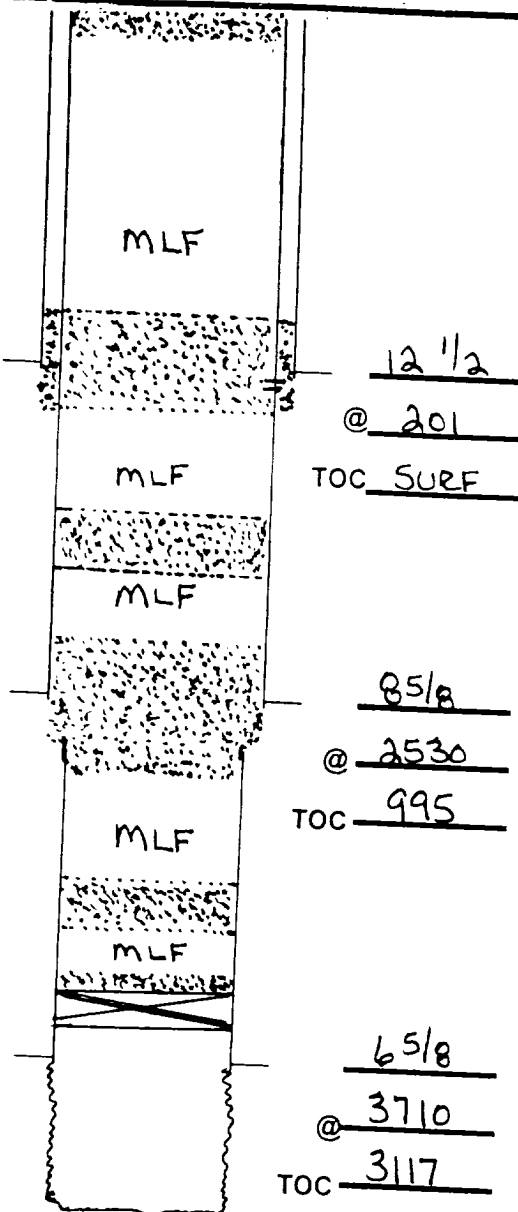

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	12 1/2	201	SURF	CIRC
INTMED 1	8 5/8	2530	995	CALC
INTMED 2				
PROD	6 5/8	3710	3117	CALC

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	
INTMED 2		
PROD	2600'	3117 - 3918

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	S-ANDRES	40	3640
YATES	2	QUEEN	40	3400
QUEEN	3	8 5/8 SHOE	75	2650
GRAYBURG	4	T-SALT	50	1100
SAN ANDRES	5	12 1/2 SHOE	75	251
CAPITAN REEF	6	SURFACE	10	10'
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BUNBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				