

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-06918
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name H.T. Mattern (NCT-B)
8. Well No. 2
9. Field name or location Penrose Skelly - CB

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well
Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Chevron USA, Inc.

3. Address of Operator
15 Smith Rd. Midland, Tx 79705

4. Well Location
Unit Letter H : 1980 feet from the North line and 660 feet from the East line
Section 31 Township 21-S Range 37-E NMPM County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI & RU
2. RIH, Tag 6" CIBP @ 3500' (Grayburg) spot 20sx plug 3500'-3400' (Queen) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine W/25# Gel p/BBL.
4. Spot 40sx plug 2800'-2600' (Yates,B-salt)
5. Perf 4 holes @ 1200', sqz 60sx plug 1200'-1100'(T-salt) WOC Tag.
6. Perf 4 holes @ 350', sqz 60sx plug 350'-200' (10 3/4" shoe) WOC Tag.
7. 10 sx surf, 10'-surf Install dry hole marker

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE P.R. Mattern TITLE HES Specialist DATE 8/28/2002
Type or print name G.R. Mattern Telephone No. 915.687.7153
(This space for State use)

APPROVED BY
Conditions of approval, if any:

ORIGINAL SIGNED BY
GARY WINK
OC FIELD REPRESENTATIVE II/STAFF MANAGER
SEP 03 2002

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR CHEVLEN USA Inc.

LEASE NAME H.T. MATTERN "B"


WELL # 2

SECT 31 TWN 21-S RNG 37E

FROM 1980 (NSL 660) (EWL)

TD 3806 FORMATION @ TD Grayburg

PBTD FORMATION @ PBTD

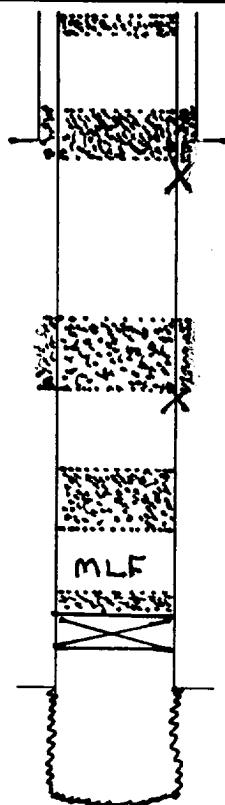

10 3/4

@ 277

TOC SURF

6"

@ 3578

TOC 2355

TD 3806

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	<u>10 3/4</u>	<u>277</u>	<u>SURF</u>	<u>Circ.</u>
INTMED 1				
INTMED 2				
PROD	<u>6"</u>	<u>3578</u>	<u>2355</u>	<u>T.S</u>

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1		PERFS
INTMED 2		OPENHOLE
PROD		<u>3578-3806</u>

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	<u>1</u>	<u>Grayburg</u>	<u>20</u>	<u>3500</u>
YATES	<u>2</u>	<u>YATES</u>	<u>40</u>	<u>2800</u>
QUEEN	<u>3</u>	<u>T-SALT</u>	<u>60</u>	<u>1200</u>
GRAYBURG	<u>4</u>	<u>10 3/4 S</u>	<u>60</u>	<u>350</u>
SAN ANDRES	<u>5</u>	<u>SURF</u>	<u>10</u>	<u>10</u>
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				