

UNITED STATES OF AMERICA
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS


(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☒ gas well ☒ other ☐
2. NAME OF OPERATOR
CONOCO INC.
3. ADDRESS OF OPERATOR
P. O. Box 460, Hobbs, N.M. 88240
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 660' FNL + 1980' FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

- REQUEST FOR APPROVAL TO: SUBSEQUENT REPORT OF:
- TEST WATER SHUT-OFF ☐ ☒
- FRACTURE TREAT ☐ ☒
- SHOOT OR ACIDIZE ☐ ☒
- REPAIR WELL ☐ ☒
- PULL OR ALTER CASING ☐ ☒
- MULTIPLE COMPLETE ☐ ☒
- CHANGE ZONES ☐ ☒
- ABANDON* ☐ ☒
- (other) TA DRINKARD

5. LEASE
LC-032096(A)
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
NMFU
8. FARM OR LEASE NAME
LOCKHART A-35
9. WELL NO.
3
10. FIELD OR WILDCAT NAME
BLINEBRY / TUBB
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
SEC. 35, T21S, R37E
12. COUNTY OR PARISH
LEA
13. STATE
NM
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

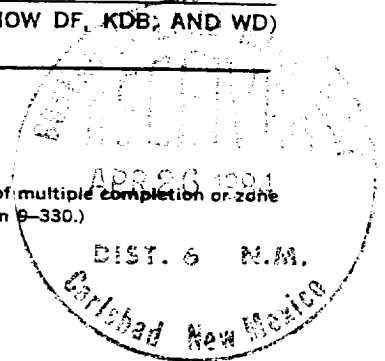

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

MIRU 3/5/84. SET PKR @ 6300', RBP @ 6334'.
SPOTTED 2 BLS 15% HCL-NE-FE 6255'-6293'. REL
PKR. PERF W/1 JSPF @ 6262', 64', 78', 80', 91' +
6293'. SET RBP @ 6321' + PKR @ 6228'. PMPD 18
BLS 28% HCL-NE-FE INTO PERFS. RESET PKR @
6003'. ACIDIZED 6070'-6224' w/210 BLS 15%

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED W. A. Drinkard TITLE Administrative Supervisor DATE 4/24/84

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____ ACCEPTED FOR RECORD

CONDITIONS OF APPROVAL: IF ANY:

RP
MAY 1 1984

*See Instructions on Reverse Side

ZA Drinkard (Posted 1000, ROSWELL, NEW MEXICO)

LOCKHART A-35 #3

HCL-NE-FE + 1500 LBS ROCKSALT. FLUSHED W/50 BBLs TFW. SWBD. REL PKR. RESET RBP @ 6029'. PERF W/1 JSPF @ 5952', 56', 58', 66', 72', 79', 80', 81', 82', 83', 84', 86', 5990', 6002', 05', 09', + 6016'. SET PKR @ 5916'. ACIDIZED W/24 BBLs 15% HCL-NE-FE. FLUSHED W/45 BBLs TFW. FRAC'D W/358 BBLs 40 # GELLED PAD + 196 BBLs 28% HCL-NE-FE. SWBD. RESET RBP @ 5930' + PKR @ 5596'. ACIDIZED 5697'-5890' W/32 BBLs 15% HCL-NE-FE. FLUSHED W/45 BBLs TFW. SWBD. RESET RBP @ 5680'. REL PKR. SPOTTED 2 BBLs ACID 5600'-5651'. PERF W/1 JSPF @ 5506', 09', 13', 27', 30', 36', 40', 48', + 5651'. SET PKR @ 5471'. ACIDIZED PERFS W/18 BBLs 15% HCL-NE-FE. FLUSHED W/35 BBLs TFW. FRAC'D 5606'-5651' W/531 BBLs 40 # GELLED PAD, 34377 LBS 20/40 SAND, + 7690 LBS 10/20 SAND. SWBD. RESET RBP @ 5593'. REL PKR. SPOTTED 4 BBLs 15% HCL-NE-FE 5466'-5568'. PERF W/1 JSPF @ 5473', 76', 80', 88', 98', 5500', 09', 15', 23', 26', 38', 43', 52', 55', 63', + 5568'. SET PKR @ 5342'. ACIDIZED W/32 BBLs 15% HCL-NE-FE. FLUSHED W/35 BBLs TFW. FRAC'D 5473'-5568' W/869 BBLs 40 # GELLED PAD, 57120 LBS 20/40 SAND, + 12600 LBS 10/20 SAND. SWBD. REL PKR + RBP. CO TO 6330'. RAN TUBS + BLINEBRY PROD EQUIP W/MODEL "D" PKR @ 5920'. TUBS PMPD 3 BO, 50 BW, <1 MCF + BLINEBRY PMPD 57 BO, 32 BW, + 480 MCF IN 24 HRS 4/17/84.