

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT - (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL ☒ Dual GAS ☐ WELL ☐ OTHER-
2. Name of Operator **ARCO Oil and Gas Company**
Division of Atlantic Richfield Company
3. Address of Operator
Box 1710, Hobbs, New Mexico 88240
4. Location of Well
UNIT LETTER **M** **660** FEET FROM THE **South** LINE AND **660** FEET FROM
THE **West** LINE, SECTION **36** TOWNSHIP **21S** RANGE **37E** N.M.P.M.

7. Unit Agreement Name
8. Farm or Lease Name
State 367
9. Well No.
1
10. Field and Pool, or Wildcat
Blinebry/Drinkard
12. County
Lea

15. Elevation (Show whether DF, RT, GR, etc.)
3361' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATIONS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER: Add Perfs to Bly & Drkd, Treat ☒	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEE RULE 1103.

1. Rig up, kill well, install BOP, POH w/Bly compl assy.
2. Rec RBP @ 5923'.
3. Perf add'l Drkd zone @ 6304-6387' w/14 holes.
4. Set RBP @ 6406', set pkr @ 6250' & treat perfs 6304-6387' w/3000 gals 15% NE acid, 12,000 gals Versagel 1400 carrying 8000# sd & 12,000 gals 20% NE acid & ball sealers. Retrieve BP & POH w/pkr.
5. Perforate add'l Blinebry 5496-5597' w/18 holes.
6. Set RBP @ 5616', set pkr @ 5300' & treat perfs 5496-5597' w/4000 gals 15% NE acid, 18,000 gals Versagel 1400 carrying 12,000# sd & 18,000 gals 20% NE acid & ball sealers.
7. Retrieve BP & POH w/pkr.
8. Run dual compl assy, test & return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED **SRK for L.D. Lane** TITLE **Dist. Drlg. Supt.** DATE **6/15/79**

Orig. Signed by
Les Clements
Oil & Gas Insp.

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:


TITLE DATE

JUN 16 1979

RECEIVED

JUN 18 1979

OIL CONSERVATION DIVISION
HOBBS, N. M.

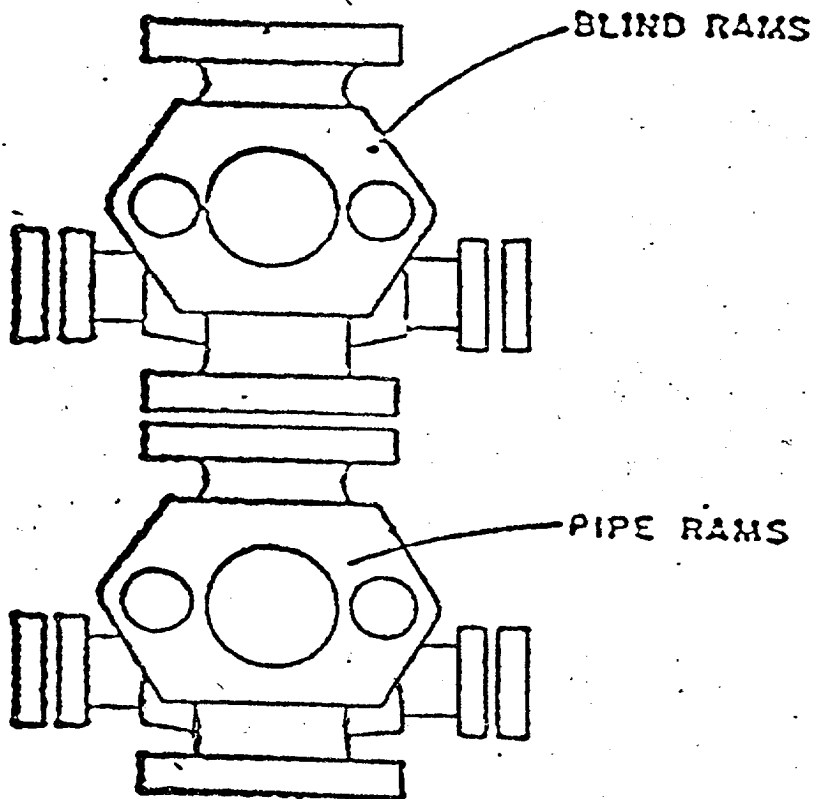

ATLANTIC RICHFIELD COMPANY
Blow Out Preventer Program

Lease Name State 367

Well No. 1

Location 660' FSL & 660' FWL
Sec 36-21S-37E, Lea County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. A wellhead fittings to be of sufficient pressure to operate in a safe manner.

RECEIVED

JUN 18 1979

OIL CONSERVATION DIVISION,
HOBBS, N. M.