

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

5. Lease Designation and Serial No.  
LC 031695B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

Warren Unit BT-TB  
WTF

8. Well Name and No.

Well # 47

9. API Well No

30-025-25828

10. Field and Pool, or Exploratory Area

Warren Blinebry Tubb O & G

11. County or Parish, State

Lea, N.M.

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Conoco, Inc.

3. Address and Telephone No

10 Desta Drive Ste. 100W, Midland, Tx. 79705-4500 (915) 686-5580/684-6381

4. Location of Well (Footage, Sec., T. R. M. or Survey Description)

1650' FNL & 710' FEL  
Sec 29, T20S, R38E,H

**12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

**TYPE OF SUBMISSION**

☐ Notice of Intent  
☒ Subsequent Report  
☐ Final Abandonment Notice

**TYPE OF ACTION**

☐ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☒ Other tubing string

☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

4-20-99: MIRU, open up well, rods stuck, worked w/rods, SION.

4-21-99: RU hot oiler, pumped hot water, got rods moving, hung well on, left pumping, shut down.


4-22-99: Pump was stuck, backed off rods, pulled rods, RUBOP, shut down.

4-23-99: Open up well, backed off rods, NDWH, NUBOP, release TAC, POOH to rods, back off rods, POOH w/ 177 jts 2 3/8", TAC, 30 jts - lay down, RIH open ended. SIWI.

4-26-99: Open up well, RIH, tag @ 7164', lay down tag tbg, hot oil tbg, RU tuboscope, POOH w/tubing, RIH w/bit-bailer tbg to top of perf. SION.

4-27-99: Pone up well finish RIH, clean out POOH w/bailer-had sand, RIH w/ 2 3/8" SN/tubing, set @5760', NDBOP, NUWH, SION.

4-28-99: RIH w/pump & rods, seat pump, load & test, check pump action. Rigged down. Pulled 6525' 2 3/8" tubing, ran back in hole w/5760' 2 3/8" tubing.

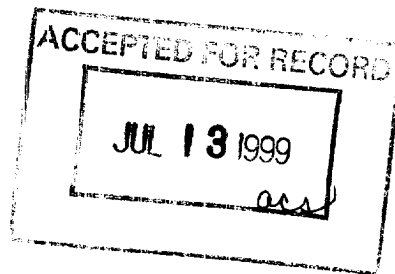

14. I hereby certify that the foregoing is true and correct.

Signed

*Ann E. Ritchie*

Title

Ann E. Ritchie  
Regulatory Agent

Date

July, 5, 1999

(This space for Federal or State office use)

Approved by

*Chris Williams*

Title

DISTRICT SUPERVISOR

Date

JUL 19 1999

Conditions of approval if any:

BLM(6)