

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	State ☒ Fee ☐
5. State Oil & Gas Lease No.	<u>B-1534</u>

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER-	7. Unit Agreement Name
2. Name of Operator <u>Conoco Inc.</u>	8. Farm or Lease Name <u>State J-2</u>
3. Address of Operator <u>P.O. Box 460 - Hobbs, New Mexico 88240</u>	9. Well No. <u>6</u>
4. Location of Well UNIT LETTER <u>0</u> , <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>east</u> LINE, SECTION <u>2</u> TOWNSHIP <u>22S</u> RANGE <u>36E</u> NMPM.	10. Field and Pool, or Wildcat <u>Arrowhead Grand</u>
15. Elevation (Show whether DF, RT, GR, etc.)	12. County <u>Lea</u>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER <u>Clean Out, Open Add'l Pay & Acidize</u> ☒	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- ① MIRU. POOH w/ rods & pump. Tag fill w/ 2 3/8" Hg & tally out of hole.
 - ② Clean out to 3872' & POOH.
 - ③ Log well from TD to 3200' & correlate to existing log. POOH.
 - ④ Perf 3742'-3842' w/ 4 spf & POOH.
 - ⑤ Set pki at 3680'
 - ⑥ Acidize 3742'-3864' w/ 90 bbls 15% HCL-NE-FE acid & 600# graded rock salt mixed in 5 bbls gelled 9" brine in 3 equal stages. Flush w/ 50 bbls 9" brine. Seaback load.
 - ⑦ Release pki at 3680' & POOH.
 - ⑧ Land SN at 3780, run pump & rods. Hang well on & place in test.
- For further information call Fay Vashler at 397-5866.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton JF TUNNEY TITLE Administrative Supervisor DATE August 15, 1988


ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

none (C-103-102) 4/8

660' FSL & 1980' FEL
 Sec 2, T-22S, R-36E
 Elev: 3520' GL; 0': 10' A6L

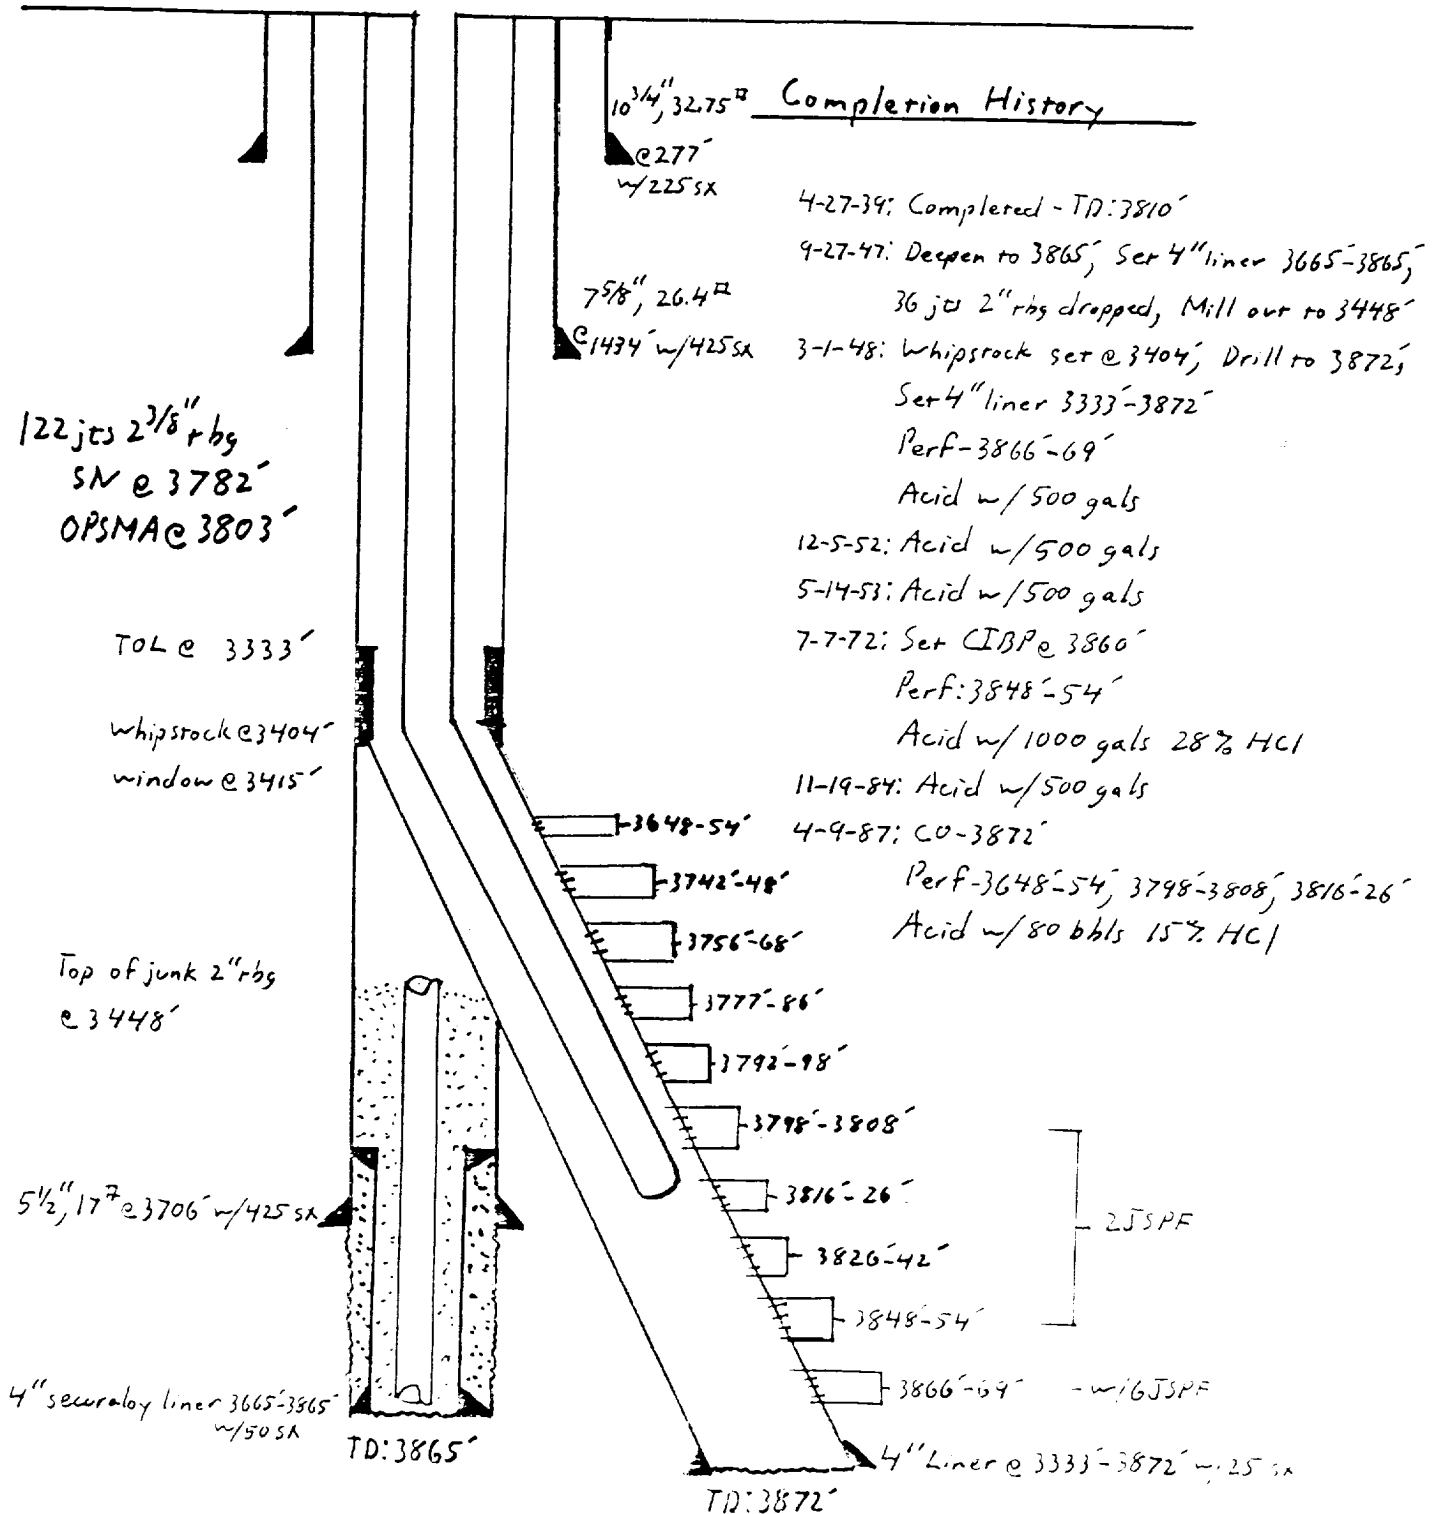

JDV

4-7-88

State J-2 No 6

Arrowhead E-M-E