

Submit 3 Copies To Appropriate District  
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

<b>WELL API NO.</b> 30-025-12518
<b>5. Indicate Type of Lease</b> STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
<b>6. State Oil &amp; Gas Lease No.</b>
<b>7. Lease Name or Unit Agreement Name:</b> Eunice Monument South Unit
<b>8. Well No.</b> 155
<b>9. Pool name or Wildcat</b> Eunice Monument Grayburg S.A.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

**1. Type of Well:**

Cil Well ☒ Gas Well ☐ Other

**2. Name of Operator** Chevron USA, Inc.

**3. Address of Operator** 15 Smith Rd. Midland, Tx 79705

**4. Well Location**

Unit Letter J : 1730 feet from the South line and 2055 feet from the East line

Section 32 Township 20-S Range 37E NMPM County Lea

**10. Elevation** (Show whether DR, RKB, RT, GR, etc.)

**11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data**

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒


CASING TEST AND CEMENT JOB ☐

OTHER: ☐

**12. Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Tag CIBP@3732' (Grayburg-San Andres) spot 40sx plug fr/3732' to 3400'(Queen) Tag @ 3284'
2. Displace hole w/MLF 9.5# Brine w/25# Gel P/BBL
3. Spot 25sx plug fr/2600' to 2400' (B-Salt) Tag @ 2315'
4. Spot 40sx plug fr/1400' to 1200' (T-Salt) Tag @ 957'
5. Spot 40sx plug fr/300' to surf (7 5/8" shoe)
6. Install dry hole marker 6-27-02

Approved as to plugging of the Well Bore.  
Liability under bond is retained until  
surface restoration is completed.

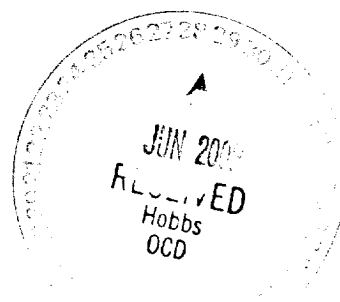

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE MANAGER/SUNSET WELL DATE 6-27-02

Type or print name Jimmy BAGLEY Telephone No. 915520-8756

(This space for State use)

APPROVED BY GARY W WINK TITLE FIELD REPRESENTATIVE II/STAFF MANAGER DA FEB 04 2003  
Conditions of approval, if any:

GWW