

WELL COMPLETION SKETCHES

LOCATION

Sec 9-225-36E
890'FNL + 990'FEL

WELL

Account 2 #60

FIELD

South Eunice

DATE

2-17-93

☐ PRESENT COMPLETION

☒ SUGGESTED COMPLETION For P+A

PERMANENT WELL BORE DATA

WELL HISTORY

8 5/8" 28" @ 1515' cmtw/500sx

Tops: Tansill - 2974


Yates - 3161

Seven Rivers - 3363

Queen - 3720

Grayburg - 3898

5 1/2" 14" @ 3905' cmtw/

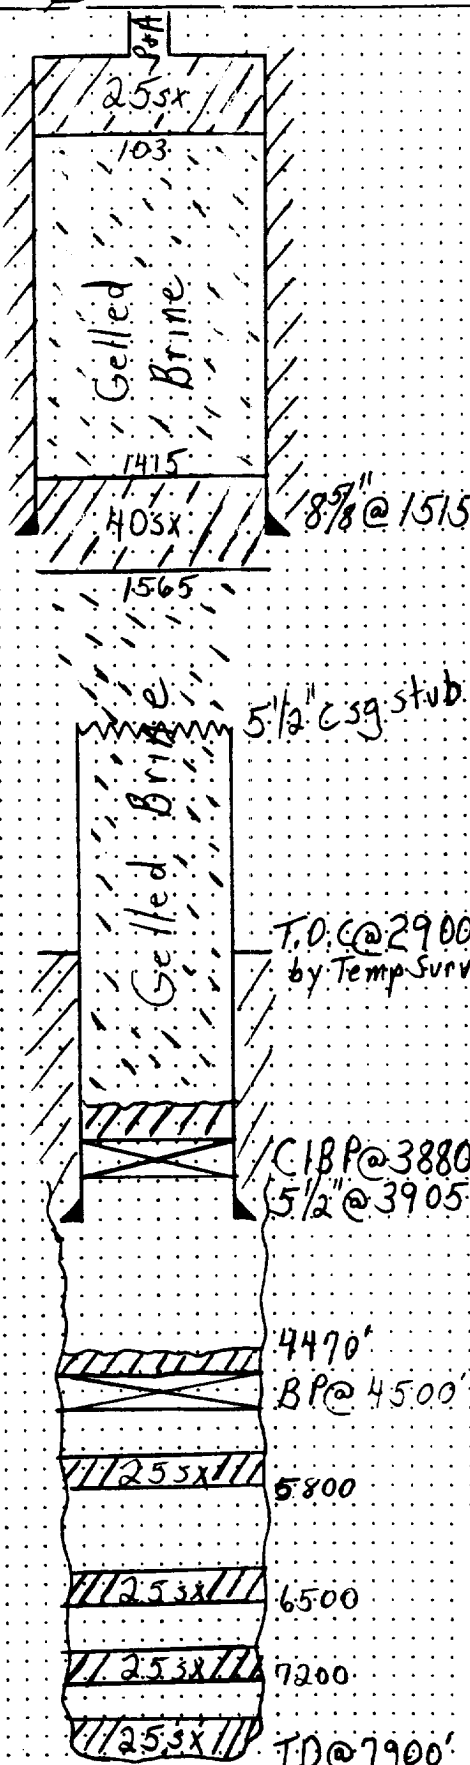

4/66 - ϕ to 7900'
* Dry Ho - *
set 25sx plugs @ 7900, 7200, 6500, 5800, 4400, 3800, 3130, 1520 + surface
5/70 - Re-enter well
 ϕ out P'ins to 4600'
Set BP @ 4500 w/ 5sx
Ran 5 1/2" csg + cemented
 ϕ out to 4470
Acid w/ 4000g
Completed as W.S.W.
9/84 - Acid w/ 4000g 15' to
9/92 - Pull sub-pump
Set CIBP @ 3880'
+ Dump 35' cmt

Proposed P+A Procedure:
1) Circulate Hole w/ 10" gel
2) Run Freepoint on 5 1/2" csg
Cut + Pull 5 1/2" csg
3) Spot 40sx Plug 1415-15
4) Spot 25sx Plug 5/3'-10'
5) Cut 8 5/8" csg 3' below
and Set P+A Marker