

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPL
(Other instructions
verse side)"E"
re-Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM-079542-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Linda Federal

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND

23-1708-R30E

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Morris R. Antweil

3. ADDRESS OF OPERATOR

Box 2010, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1960' PSL & 1980' FWL Sec. 23-T208-R30E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3563' GR

12. COUNTY OR PARISH

Lea

13. STATE

New Mex.

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☒CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Drilled 7-7/8" hole to TD 9478' Granite. Prep to P & A as follows:

1. 35 sx cmt plug across top of Ellenburger @ 3404'.
2. 35 sx plug across top of Makee @ 9078'.
3. 35 sx plug across top of Devonian @ 7769'.
4. 35 sx plug across top of Glorieta @ 5518'.
5. 35 sx plug across top of San Andres @ 4229'.
6. 35 sx plug across 8-5/8" csg shoe @ 3000'.
7. Will move off rotary drlg equipment & move in csg plg unit.
8. Will cut & pull free 8-5/8" csg.
9. Spot 35 sx plug across stub of 8-5/8" csg or across top of Anhydrite @ 1565', whichever is shallower.
10. Spot 35 sx plug across shoe of 12-3/4" csg @ 310'.
11. Spot 10 sx surface plug w/marker.

APPROVED SUBJECT TO POSSIBLE FUTURE
REQUIREMENT THAT PAVED HIGHWAY ROAD
BE RIPPED AND RELAYEDNOTIFY US IN TIME TO
WITNESS PULING OPERATIONS

18. I hereby certify that the foregoing is true and correct

SIGNED

R M Williams

TITLE

Agent


(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

17 June 1974

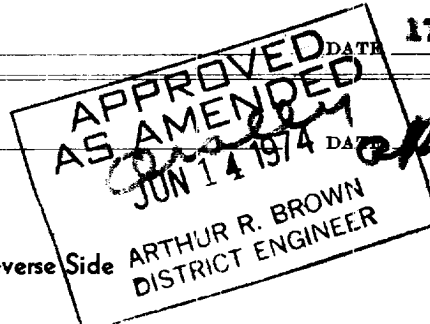

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963—O-685229

847-851

RECEIVED

APR 11 1964

U.S. DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

APPROVED
FOR ABANDONMENT
JUN 11 1964
DISTRICT ENGINEER
FORTY-THREE