

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

LC 0634586

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Warren Unit B-T #53

9. API Well No.

30 025 25916

10. Field and Pool, or Exploratory Area

Warren Blinebry-Tubb O & G

11. County or Parish, State

Lea County, NM

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

CONOCO INC.

3. Address and Telephone No.

10 DESTA DR. STE. 100W, MIDLAND, TX. 79705-4500 (915) 686-5580/684-6381

4. Location of Well (Footage. Sec., T. R. M. or Survey Description)

Sec 26, T20S, R38E, 660' FNL & 1980' FWL

CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Repon
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Put back on production

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

12-28-00: RIH and tagged @ 6737'. RIH w/RBP & packer, set @ 6718'. Pulled packer above perfs @ 6552-6706'.

12-19-00: Set packer @ 6710', acidized Tubb w/500 gals 15% NEFE HCL. SIOWE.


12-22-00: RIH & pulled RBP to 4000'. SI over holiday.

1-2-01: RIH w/RBP & Packer. Set RBP @ 6327', packer @ 6296'. Tested packer, pulled up to 5850'. Acidized Blinebry w/250 gals 15% NEFe HCL. Prep to swab & pump scale squeeze. SION.

1-4-01: Retrieved RBP, pulled up & SION.

1-5-01: POOH w/RBP, RIH w/production tubing, begin in hole w/rods & pump. SI.

1-8-01: Prep hole & run pump. Well put back on production 1-12-01.

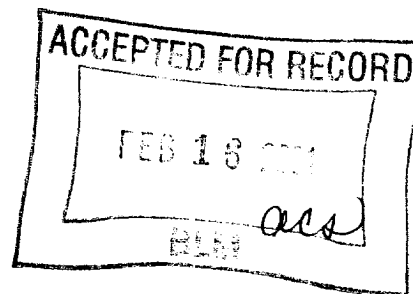

14. I hereby certify that the foregoing is true and correct.

Signed

Title

Ann E. Ritchie
Regulatory Agent

Date

2-8-01

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval if any:

BLM(6)

REC'D
FEB 12 1968
FBI - NEW YORK