

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil ns. Division
P.O. Box 1980
Hobbs, NM 88241

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.
NM-81272

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Prize Federal #4

9. API Well No.

30-025-32436

10. Field and Pool, or Exploratory Area

W. Red Tank Delaware

11. County or Parish, State

Lea County, NM

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Pogo Producing Company

3. Address and Telephone No.

P. O. Box 10340, Midland, TX 79702-7340 (915)685-8100

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1880' FNL & 760' FEL, Section 27, T22S, R32E

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other Add Delaware Perfs

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

09/10/96 Perf Delaware 7462'-70' (16 - .50" dia holes).


09/11/96 Set RBP @ 7742'. Acdz perfs 7462'-70' w/ 250 gals 15% HCL. Swab test.

09/13/96 Latch onto RBP @ 7742' & POOH. Lay down RBP.

09/14/98 Set RBP @ 6880'. Perf Delaware 6906'-12' (12 - .50" dia holes) & 6832'-38' (12 - .50" dia holes). Acdz perfs 6832'-38' & 6906' - 12' w/ 500 gals 15% HCL. Swab test.

09/15/98 Latch onto RBP @ 6880' & POOH. Lay down RBP.

09/17/98 Run production equipment. Put well on pump.

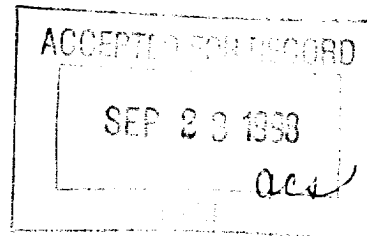

14. I hereby certify that the foregoing is true and correct

Signed Barrett Smith

Title Division Operations Engineer

Date 09/15/98

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title

Date