

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999


SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-04637
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator Chevron USA, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd., Midland, TX 79705		7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
4. Well Location Unit Letter <u>G</u> : 1980 feet from the <u>North</u> line and 1980 feet from the <u>East</u> line Section <u>14</u> Township <u>21-S</u> Range <u>36-E</u> NMPM Lea County		8. Well No. 391
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Eunice Monument, Grayburg SA

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐ OTHER: ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI & RU.
2. RIH Tag CIBP @ 3645' (Grayburg) Spot 30 Sx plug 3645'-3400' (Queen) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# Gel P/BBL.
4. Spot 25 Sx plug 2600'-2400', (B-Salt) ~~WOC Tag~~
5. Spot 30 Sx plug 1500'-1200', (7 5/8" Shoe, T-Salt) WOC Tag.
6. Spot 35 Sx plug 350'-Surf (10 3/4" Shoe, Surface) WOC Tag.
7. Install dry hole marker.

FIELD REPRESENTATIVE MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

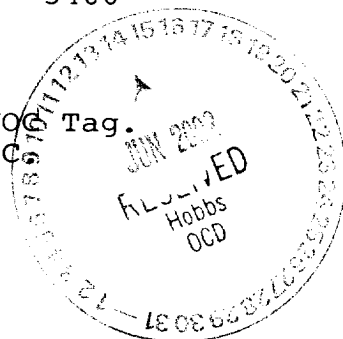

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 6/5/2002

Type or print name G.R. Bledsoe Telephone No. 915.687.7153
(This space for State use)

APPROVED BY GARY W. WINK TITLE CC FIELD REPRESENTATIVE II/STAFF MANAGER DATE JUN 14 2002

Conditions of approval, if any:

PLUGGING & ABANDONMENT WORKSHEET

OPERATOR CHEVRON USA INC.
LEASE NAME EUNICE MONUMENT SOUTH UNIT
WELL # 391

SECT 14 TWN 21-S RNG 36-E
FROM 1980 NSL 1980 BWL
TD 3940 FORMATION @ TD
PBTD FORMATION @ PBTD Grayburg

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	10 3/4	270	SURF	CIRC
INTMED 1	7 5/8	1423	73'	CALC
INTMED 2				
PROD	5 1/2	3695	1475	CALC

	SIZE	TOP	BOT	TOC	DETERM ED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	
INTMED 2	OPENHOLE	3695 - 3940
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP		3645
YATES	2	QUEEN	20	3645
QUEEN	3	B-SALT	25	2600
GRAYBURG	4	7 5/8 SHOE	30	1500
SAN ANDRES	5	10 3/4 SHOE	35	350
CAPTAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				

