

Mr., Hobbs, NM 88240

on First, Artesia, NM 88210

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

1000 Rio Brazos Rd., Aztec, NM 87410

District IV
2040 South Pacheco, Santa Fe, NM 87505

WELL API NO. 30-025-04654
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
8. Well No. 422
9. Pool name or Wildcat Eunice Monument, Grayburg, SA

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injection	7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
2. Name of Operator Chevron USA, Inc.	8. Well No. 422
3. Address of Operator 15 Smith Rd., Midland, Texas 79705	9. Pool name or Wildcat Eunice Monument, Grayburg, SA
4. Well Location Unit Letter <u>N</u> : <u>660</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>West</u> line Section <u>16</u> Township <u>21-S</u> Range <u>36-E</u> NMPM County <u>Lea</u>	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐
OTHER: ☐	


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐	ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐	
OTHER: ☐	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI & RU.
2. Set 7" CIBP @ 3475', (Grayburg) Spot 40 Sx plug 3475'-3300' (Queen) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# Gel P/BBL.
4. Spot 40 Sx plug 2600'-2400' (B-Salt) ~~WOC Tag.~~
5. Cut 7" Csg @ 1770', L/D Csgs.
6. Spot 90 Sx plug 1820'-1500', (Stub, 9 5/8" Shoe, T-Salt) WOC Tag.
7. Spot 60 Sx plug 360'-200', (12 1/2" Shoe) WOC Tag.
8. 10 Sx Surface, Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

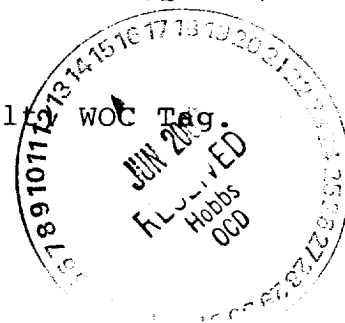

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE D.R. Bledsoe TITLE HES Specialist DATE 6/12/2002

Type or print name G.R. Bledsoe Telephone No. 915.682.7153
(This space for State use)

APPROVED BY DATE JUN 14 2002
Conditions of approval, if any: OC FIELD REPRESENTATIVE / STAFF MANAGER

ORIGINAL SIGNED BY

DATE

OC FIELD REPRESENTATIVE / STAFF MANAGER

ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVR

USA Inc.

LEASE NAME EUNICE MONUMENT SOUTH UNIT

WELL # 422

SECT 16

TWN 21-S

RNG 36-E

FROM 660

NOL 1980

EWL

TD 3912

FORMATION @ TD

PBTD

FORMATION @ PBTD GRAYBURG

MLF

12 1/2

@ 301

TOC SURF

MLF

9 5/8

@ 1720

TOC SURF


MLF

SOZ 7" CSQ
W/225 SX CMT
Then PERFS @ 2359'
(1988)

7"

@ 3760

TOC 2706

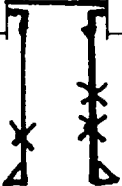

TD 3912

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	12 1/2	301	SURF	Circ
INTMED 1	9 5/8	1720	SURF	Circ
INTMED 2				
PROD	7"	3760	2706	CALC

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1	4 1/2	3513	4065	3513	Circ
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1		PERFS 3831-4044
INTMED 2		OPENHOLE
PROD	1770	

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP		3475
YATES	2	QUEEN	40	3475
QUEEN	3	B-SALT	40	2600
GRAYBURG	4	9 5/8 SHOE	90	1820
SAN ANDRES	5	12 1/2 SHOE	60	360
	6	SURF	10	10
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				

