

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-04745
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator: Chevron USA, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator: 15 Smith Rd. Midland, Tx 79705		7. Leave Name of Unit Agreement Notice Eunice Monument South Unit
4. Well Location Unit Letter J : 1980 feet from the South line and 1980 feet from the East line Section 21 Township 21-S Range 36-E NMPM County Lea		8. Well No. 454
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Production or Withdrawal Eunice Monument Grayburg S.A.

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐


SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RIH Tag 5 1/2" CIBP @ 3693' (Grayburg-Queen) spot 30sx plug fr/3693' to 3400' Tag @ 3389'
2. Displace hole w/MLF, 9.5# Brine w/25# Gel p/BBL
3. Spot 25sx plug fr/2600' to 2400 (B-salt)
4. Perf 4 holes @ 1510' sqz w/50sx fr/1510' to 1300' (7 5/8" shoe, T-salt) Tag @ 1264'
5. Perf 4 holes @ 250' sqz w/75 fr/250' to surf (13 3/8" shoe) Tag @ surf
6. Install dry hole marker 8-21-02

Approved as to plugging of the Well Bore.
Liability of well is retained until
surface restoration is completed.

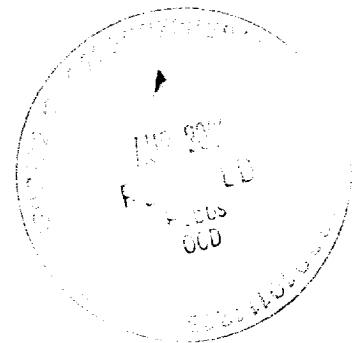

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE MANAGER/SUNSET DATE 8-21-02

Type or print name Timmy BAGLEY Telephone No. 915 520-8756
(This space for State use)

APPROVED BY [Signature] TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE FEB - 6 2003
Conditions of approval [Signature]

GWW