

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06386
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Northeast Drinkard Unit
8. Well No.	104
9. Pool name or Wildcat	N.Eunice Blinbry-Tubb-Drinkard
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3491' KB

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	
2. Name of Operator Shell Western E&P, Inc.	
3. Address of Operator P.O. Box 576 Houston, TX 77001 5239 WCK	
4. Well Location Unit Letter E (5) : 1582' Feet From The North Line and 330' Feet From The West Line	
Section 33 Township 21S Range 37E NMPM Lea County	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: TA'D ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-9 To 3-15-95

This Approval of Temporary  
Abandonment Expires 5-1-2000

POOH w/Prod Equip. Set CIBP @ 5540' and cap w/35' cmt. PT csg to 500#, would not hold. Isolated csg leak from 4478' to 4529'. Set CICR @ 4371'. Sqz csg w/29 BBLS Class C Neat. Circ hole cln. PT csg to 500 # for 30 min. (Chart Attached). Secured well for TA'D status. Well TA'D.

Pursuant to the provisions of NMCD Rule 203, Shell Western E&P Inc. hereby requests temporary abandonment status for a period of five years.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Shirley Smith TITLE Mgr. - Reg. & Permitting DATE 5-3-95

TYPE OR PRINT NAME G. S. Nady TELEPHONE NO. 713/544-4219

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT I SUPERVISOR

MAY 12 1995


APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

**RECEIVED**

**17 JUL 1995**

**CLC HOBBS  
OFFICE**

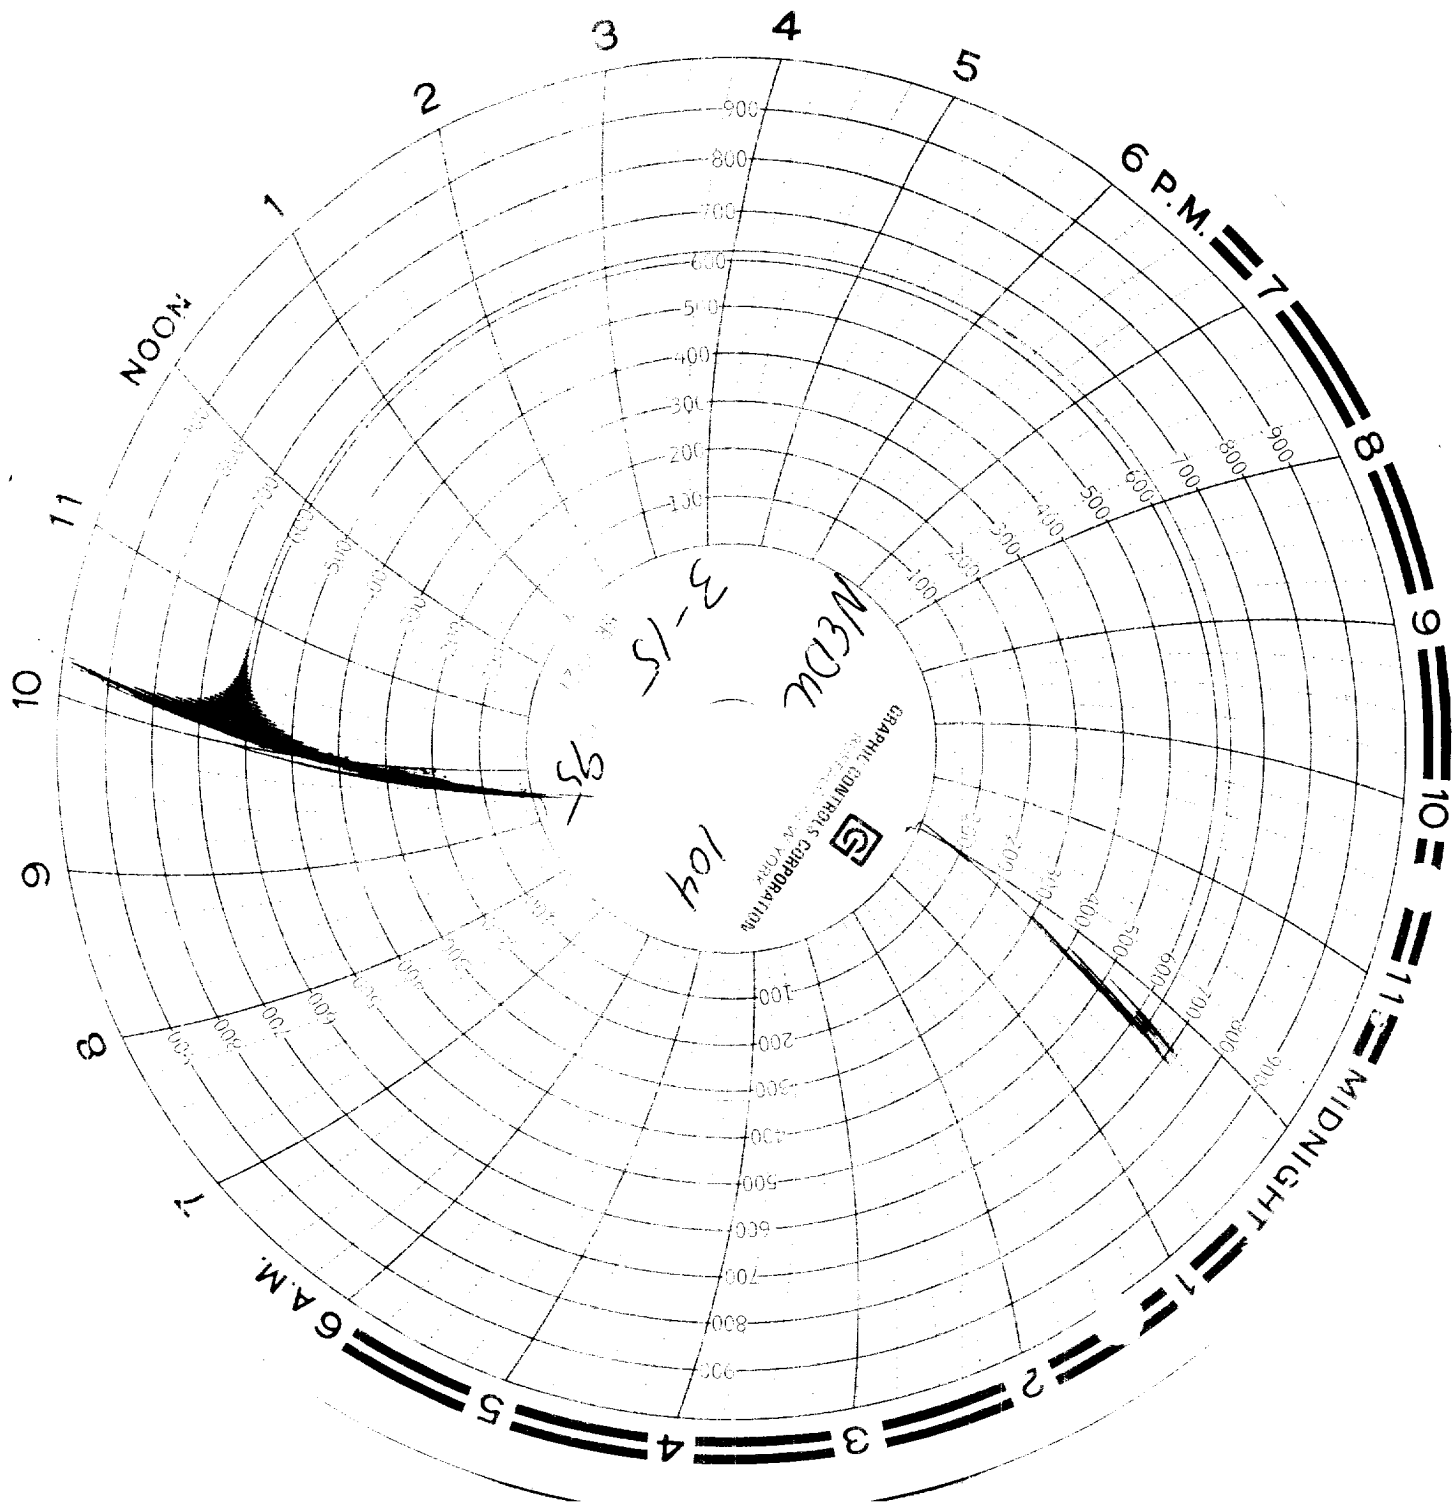

SHELL  
V.E.D.U. 104  
3-15-95  
Gold Star Service Co.  
Johnny Martin

Robert N. Gilburt  
Shell Western E&P Inc  
3-15-95

NORTH EAST DRINKARD Unit  
# 104