

NEW MEXICO OIL CONSERVATION COMMISSION
SANTA FE, NEW MEXICO

HOBBS OFFICE OCC

MISCELLANEOUS NOTICES

1959 MAR 5 AM 10:48

SUBMIT THIS NOTICE IN TRIPLICATE TO THE DISTRICT OFFICE, OIL CONSERVATION COMMISSION, BEFORE THE WORK SPECIFIED IS TO BEGIN. A COPY WILL BE RETURNED TO THE SENDER ON WHICH WILL BE GIVEN THE APPROVAL, WITH ANY MODIFICATIONS CONSIDERED ADVISABLE, OR THE REJECTION BY THE COMMISSION OR AGENT, OF THE PLAN SUBMITTED. THE PLAN AS APPROVED SHOULD BE FOLLOWED, AND WORK SHOULD NOT BEGIN UNTIL APPROVAL IS OBTAINED. SEE ADDITIONAL INSTRUCTIONS IN THE RULES AND REGULATIONS OF THE COMMISSION.

INDICATE NATURE OF NOTICE BY CHECKING BELOW

NOTICE OF INTENTION TO CHANGE PLANS		NOTICE OF INTENTION TO TEMPORARILY ABANDON WELL		NOTICE OF INTENTION TO DRILL DEEPER	
NOTICE OF INTENTION TO PLUG WELL		NOTICE OF INTENTION TO PLUG BACK		NOTICE OF INTENTION TO SET LINER	
NOTICE OF INTENTION TO SQUEEZE		NOTICE OF INTENTION TO ACIDIZE		NOTICE OF INTENTION TO SHOOT (NITRO)	
NOTICE OF INTENTION TO GUN PERFORATE		NOTICE OF INTENTION (OTHER) Disturb Tubing	X	NOTICE OF INTENTION (OTHER)	

OIL CONSERVATION COMMISSION
SANTA FE, NEW MEXICO

Hobbs, New Mexico

March 4, 1959

(PLACE)

(DATE)

GENTLEMEN:

FOLLOWING IS A NOTICE OF INTENTION TO DO CERTAIN WORK AS DESCRIBED BELOW AT THE

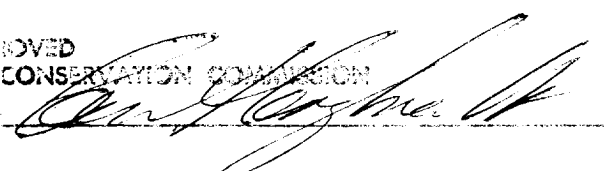
Humble Oil & Refining Company New Mexico State V Well NO. 11 IN K
(COMPANY OR OPERATOR)
NE 1/4 SW 1/4 OF SEC. 10, T. 21-S, R. 37-E, NMPMA, Blinbry and Tobbs (UNIT) POOL
(40-ACRE SUBDIVISION)
Lea COUNTY.

FULL DETAILS OF PROPOSED PLAN OF WORK
(FOLLOW INSTRUCTIONS IN THE RULES AND REGULATIONS)

To check for a leak in the tubing, the following work is proposed:

1. Set a blanking plug in the 2-inch tubing at 6035 feet.
2. Open circulating valve at 5967 feet and kill Blinbry zone.
3. Unlatch from tubing receptacle at 6000 feet and pull tubing.
4. Repress tubing receptacle seal nipple and change out circulating valve.
5. Run tubing. Pressure test going in hole.
6. Latch into tubing receptacle. Pressure test string.
7. Open circulating valve at 5967 feet and swab in Blinbry zone.
8. Close circulating valve and remove blanking plug.
9. Conduct packer leakage test.

Note: See C-102s dated January 22, 1959 and January 26, 1959.

APPROVED _____, TO
EXCERPT AS FOLLOWS:APPROVED
OIL CONSERVATION COMMISSION
BY 
TITLE _____

Humble Oil & Refining Company

ORIGINAL COMPANY OR OPERATOR

BY _____ SIGNED: ARVIN D. EADY

POSITION Agent

SEND COMMUNICATIONS REGARDING WELL TO:

NAME Humble Oil & Refining Company

ADDRESS Box 2347, Hobbs, New Mexico