

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIP!
(Other instructions
verse side)

TE*
re-

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. UNIT AGREEMENT NAME NAFBU	
2. NAME OF OPERATOR Continental Oil Company		8. FARM OR LEASE NAME Lockhart 8-11	
3. ADDRESS OF OPERATOR Box 450, Nacogdoches, N. M.		9. WELL NO. 16	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980 F&I & 1980 F&I, Sec. 11-218-17E, Lea County, New Mexico		10. FIELD AND POOL, OR WILDCAT Drinkard & F B Pools	
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 11-218-17E	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3446 LB		12. COUNTY OR PARISH Lea	
		13. STATE N. M.	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) Multiple complete ☒

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1980 well was a White Oak & Drinkard oil dual. Work done:
Perforated Blinberry at 5750, 5758, 5765, 5771, 5781, 5793, 5803, 5811,
5836, 5845, 5850, 5861, 5891, 5897, 5929, 5938, 5940, 5961, 6004, 6023
& 6044 w/1 5897. Perforated Blinberry perfs. 5827-5897 w/1,040 gal. 15%
HSTNE acid followed by 30,000 gal. crude using 30,000 sand & 1500#
"ADOMITE" additive. Perforated Blinberry perfs. 5827-5897 w/1,000 gal. 15%
HSTNE acid followed by 30,000 gal. crude using 30,000 sand and 1500#
"ADOMITE" additive. Perforated Blinberry perfs. 5750-5898 w/1,000 gal. 15%
acid followed by 30,000 gal. crude using 30,000 sand & 1500# "ADOMITE"
additive.
Workover started 6-9-61. Workover completed 1-11-62.

On 7F Blinberry closed 262 this oil, 6 BW in 21 hrs. w/320 MCFWPS,
16/64" choke, 10R 721.

ILLEGIBLE

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Isaac Supervisor


DATE 6-22-64

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

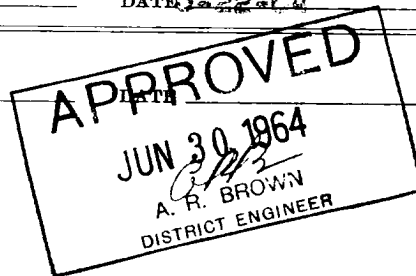

*See Instructions on Reverse Side

USG (5) WMOG (1) JB
For in-Rooms (5) 11-106 (5)
GAS, 11-106 & 11-106 (5)

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.