

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06602
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Northeast Drinkard Unit
8. Well No.	705
9. Pool name or Wildcat	ON. Eunice Blinbry-Tubb-Drinkard
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3429' DF 3417' GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	2. Name of Operator Shell Western E&P, Inc.
3. Address of Operator P.O. Box 576 Houston, TX 77001	ATTN: SHIRLEY GALIK 5239 WCK
4. Well Location Unit Letter N : 330' Feet From The South Line and 3210' Feet From The West Line	5. Section 15 Township 21S Range 37E NMPM Lea County

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	
OTHER: <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: OAP/AT/SQZ: TA'D <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6/2/95 To 6/22/95

POOH w/Prod Equip. Perf the following intervals: 5550-5680, 6086- 6132, 6420-30 (1 JSPF).
RIH w/RBP and PKR. Set PKR @ 5500'. AT w/3200 gal 28% HCL Foamed Acid 1276 SCF Nitrogen.
Rel PKR and RBP. POOH w/tools to 5000'. Csg collapsed. RIH w/Overshot, retrieved PKR and
RBP. RIH w/sledge and worked through tight spot and casing. POH.

Set CIBP @ 6385', 6070' and 5530' and cap each w/20' cmt. Set PKR @ 5020'. PT csg to 500# -
Held good. (Chart Attached). POH w/tbg & Pkr. Set Ret @ 5020. Sqz casing leak w/100 sx cmt
32 sx Neat cmt in formation & 10' on top of Retainer. Circ hole clean.
Secured well for TA'D status.
Well is TA'D.

This Approval of Temporary
Abandonment Expires 10-1-2000

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Shirley A. Galik TITLE Mgr. - Reg. & Permitting DATE 10/5/95
TYPE OR PRINT NAME For: G. S. Nady TELEPHONE NO. 713/544-4219

(This space for State Use)

ORIGINAL SIGNED BY JERRY NEXTON
DISTRICT I SUPERVISOR


APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

JCS

dp

OCT 11 1995



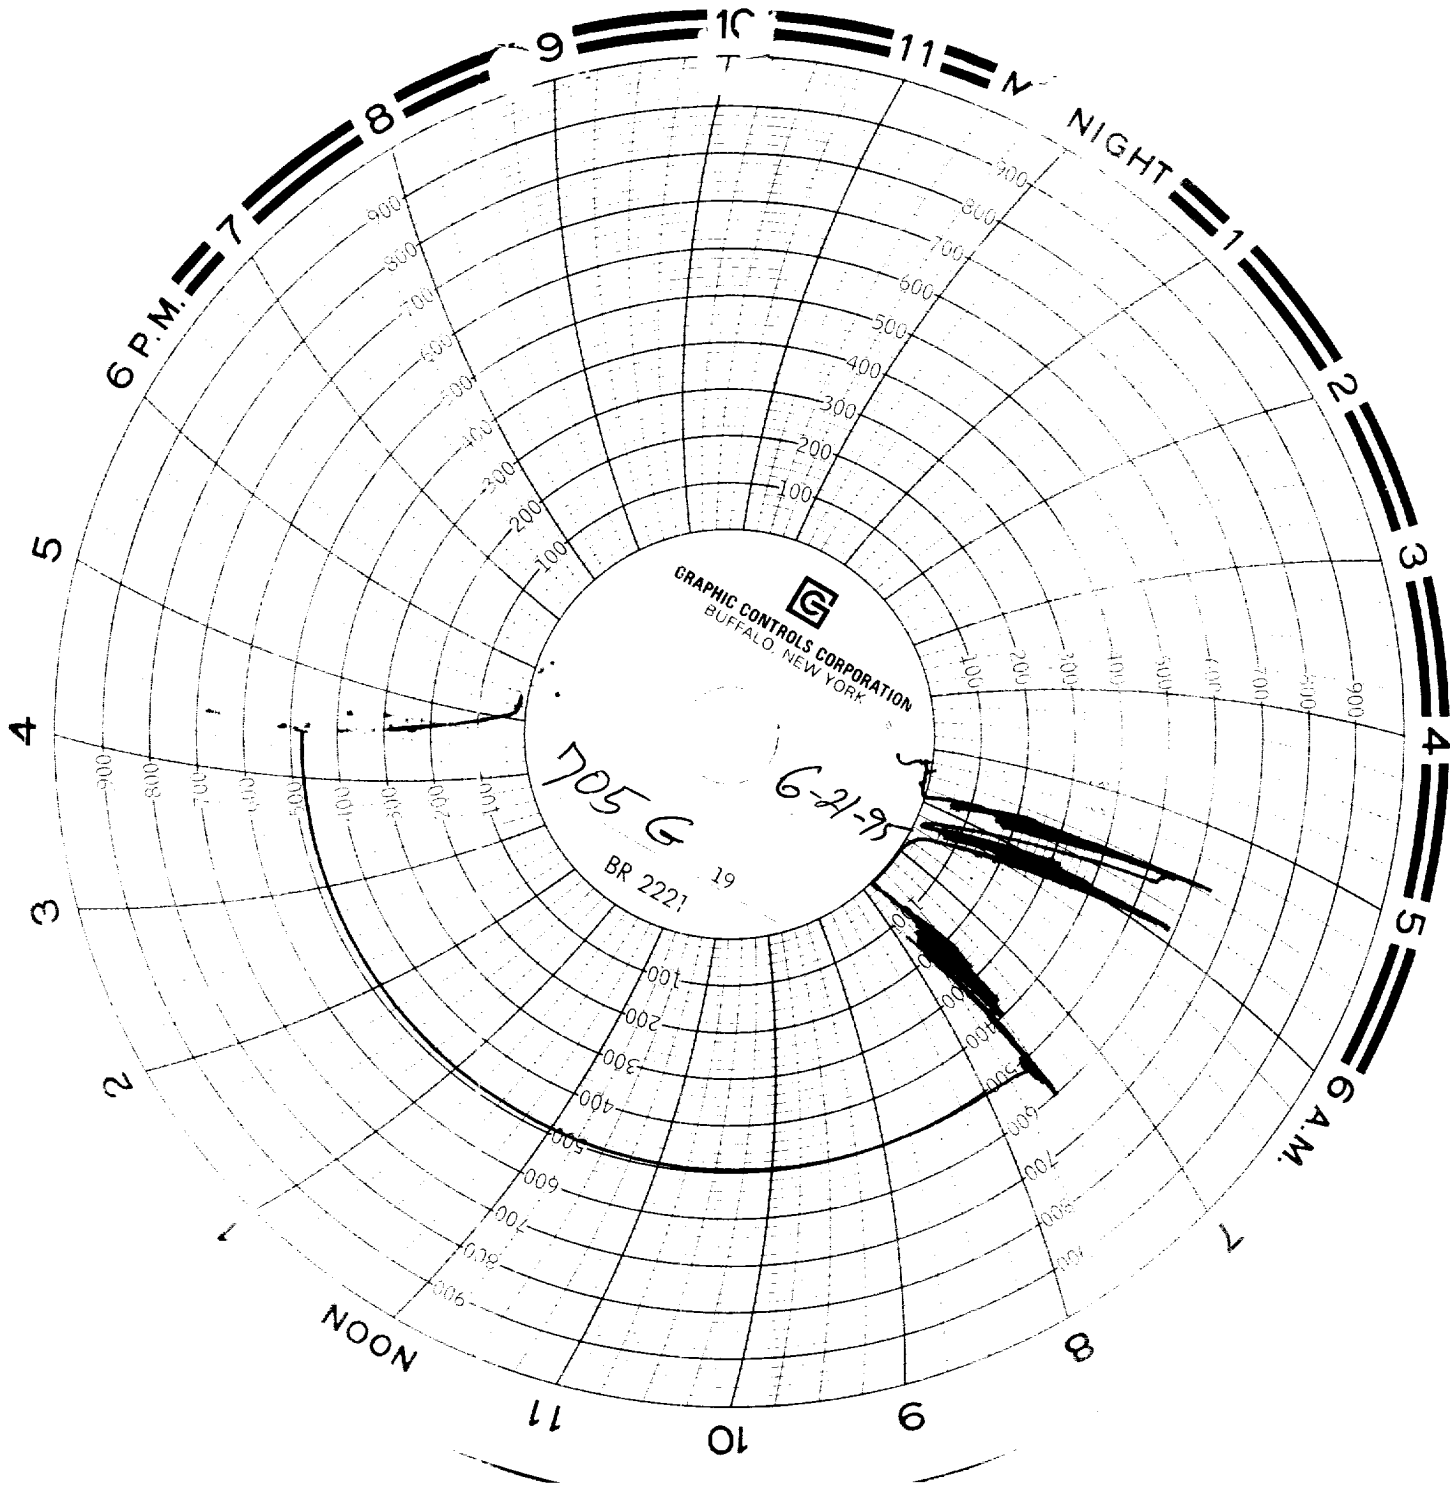

Robert M. Stewart

NEON

705

Shall Western
CPI INC.

NEON #7056

KL []
#112

6-21-95