

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO. 30-025-24023
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 2667
7. Lease Name or Unit Agreement Name: Harry Leonard NCT"C"
8. Well No. 13
9. Pool name or Wildcat Blinebry

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

Chevron USA, Inc.

3. Address of Operator

15 Smith Rd. Midland, tx 79705

4. Well Location

Unit Letter B : 510 feet from the north line and 1780 feet from the east line

Section 36

Township 21-S Range 36-E NMPM

County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐


CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU
2. Set 4" CIBP in liner @ 6470, spot 20sx plug 6470-6270 (Drinkard) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# Gel P/BBL.
4. Spot 50sx plug 5935-5450 (Top liner, Blinebry sqz'd perfs, 5 1/2 shoe) WOC TAG
5. Spot 25sx plug 3400-3200 (Queen)
6. Spot 25sx plug 2700-2500 (B-salt, Yates) WOC Tag.
7. Perf 4 holes @ 1300. sqz 50sx plug 1300-1100 (8 5/8 shoe, T-salt) WOC Tag.
8. Perf 4 holes @ 300, sqz 70sx plug 300-surf (surface) WOC TAG.
9. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

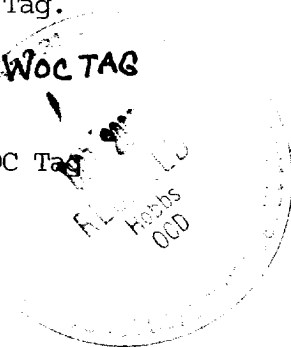

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G. R. Bledsoe

TITLE HES Specialist

DATE 10/22/2002

Type or print name G. R. Bledsoe

Telephone No. 915.687.7153

(This space for State use)

APPROVED BY

Conditions of approval, if any:

ORIGINAL SIGNED BY

CHRYL W. WINK

OIL FIELD REPRESENTATIVE II/STAFF MANAGER

OCT 31 2002

[Handwritten signature]

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR CHE IN USA INC

LEASE NAME HARRY LEANED NCT "C"


WELL # 13

SECT 36 TWN 21-S RNG 36-E

FROM 510 NSL 1780 EWL

TD 6806 FORMATION @ TD Drinkard

PBTD FORMATION @ PBTD Blinbery

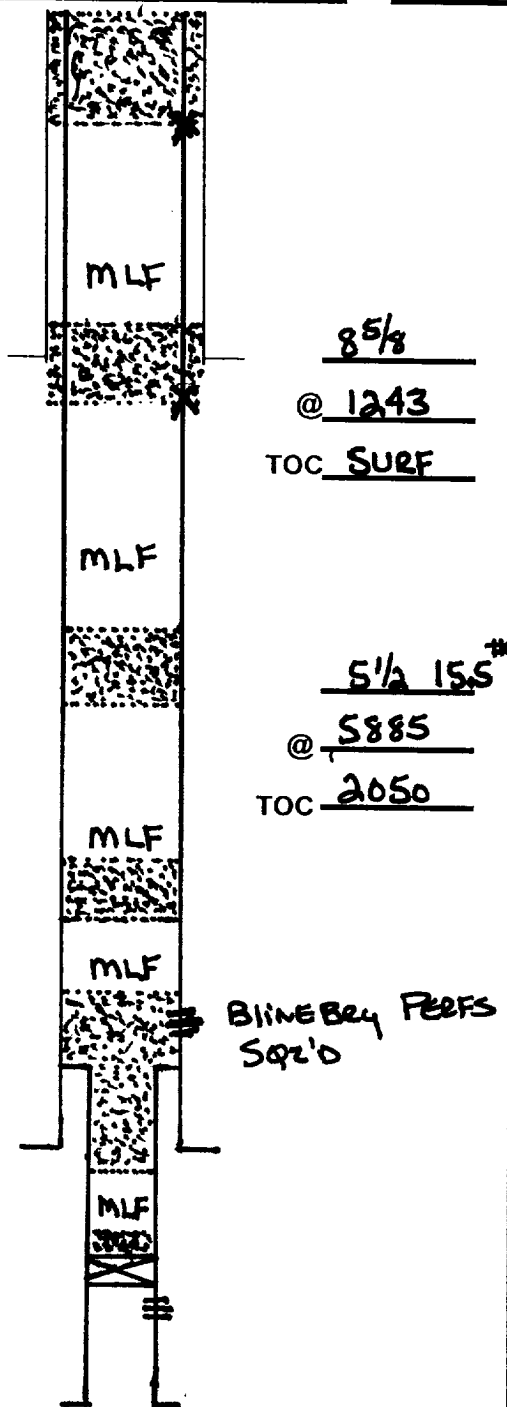

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	8 5/8	1243	SURF	Ciec
INTMED 1				
INTMED 2				
PROD	5 1/2	5885	2050	T.S

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1	4"	5774	6806	5774	Ciec
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	6517 - 6703
INTMED 2	OPENHOLE	
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP	20	6470
YATES	2	5 1/2 S	50	5935
QUEEN	3	QUEEN	25	3400
GRAYBURG	4	B-SALT	25	2700
SAN ANDRES	5	8 5/8 S	50	1300
	6	F.W	70	300
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				