

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPL
(Other instructions
reverse side)

E*
re-

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

34-14330-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

Salt Lake South Unit

8. FARM OR LEASE NAME

Salt Lake South Unit

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 21-21S-32E

12. COUNTY OR PARISH

Lea

13. STATE

New Mexico

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Skelly Oil Company

3. ADDRESS OF OPERATOR

P. O. Box 1351, Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

Unit Letter "D", 660' FNL & 660' FWL, Sec. 21-21S 32E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3679' KB

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

Perforate, treat and test Wolfcamp & Strawn Formations

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) Moved in workover rig 1-3-75. Pulled tubing.
- 2) Set cast iron bridge plug at 13,200'. Spotted two sacks cement 13,176-13,200'.
- 3) Spotted 750 gals. acetic acid to 11,950'. Flushed with 66 bbls. KCl water.
- 4) Perforated 5" OD casing liner with one 0.33' diameter hole at 11,928', 11,929', 11,930', 11,931', 11,932', 12,211', 12,213', 12,215', 12,217', 12,220', 12,295', 12,299', 12,302', 12,305', 12,308', 12,317', 12,972', 12,979', 12,982', 12,986', and 12,992' (Total 21 shots).
- 5) Treated Wolfcamp perfs. 11,928-12,317' and Strawn perfs. 12,972-12,992' with 10,000 gals 15% acid, 50 ball sealers, and 225 MCF nitrogen. Flushed with 60 bbls. 2% KCl water.
- 6) On 1-7-75 swabbed and flowed Wolfcamp perfs. 11,928-12,317' and Strawn perfs. 12,972-12,992' for 25 MCFGPD. On January 13, 1975, swabbed perfs. 4 hours, 25 bbls. water, no gas.
- 7) On January 14, 1975, well was shut in for pressure buildup for Wolfcamp perfs. 11,928-12,317' and Strawn perfs. 12,972-12,992'.

18. I hereby certify that the foregoing is true and correct

SIGNED

D. R. Crow

TITLE

Lead Clerk

DATE

1-15-75

(This space for Federal or State office use)


APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

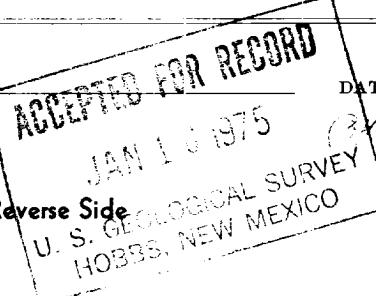

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing; pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.