


HANK B-1, Well No. 16
PROPOSED COMPLETION EQUIPMENT

9 5/8", 36 #/ft CS4 @ 1350'
W/480 SX.

Grayburg PERFS 3707'

Drinkard PERFS

6825 T.D.-

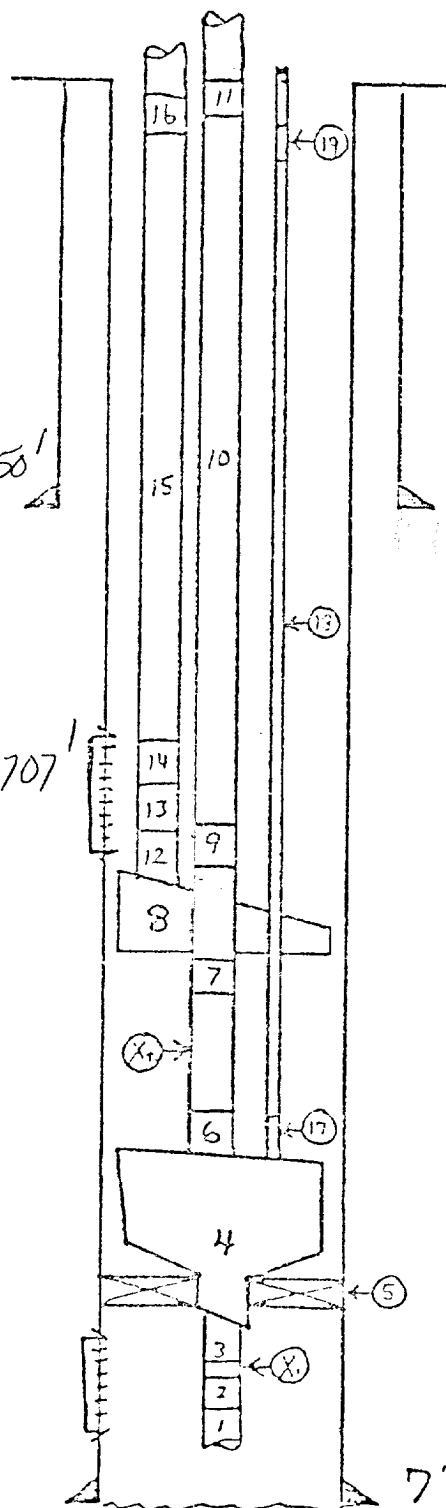

1. 1 JT. 2 3/8" BUTTRESS TEG O.E.
2. TUGS S.N. - BUTTRESS
- X₁ 2 3/8" BUTTRESS TEG.
3. X-OVER 2 3/8" BUTT. X EUEB.
4. VENT HEAD ASSY.
5. PKR OTIS "WB" @
6. X-OVER 2 3/8" BUTT. X EUEB.
- X₂ 2 3/8" BUTTRESS TEG.
7. X-OVER 2 3/8" BUTT. X EUEB.
- 8.* TRIPLE STRING ANCHOR
9. X-OVER 2 3/8" BUTT. X EUEB.
10. 2 3/8" BUTTRESS TEG.
11. X-OVER 2 3/8" BUTT. X EUEB.
12. J-LATCH ASSY.
13. X-OVER 2 3/8" BUTT. X EUEB.
14. BLINDBRY S.N. - BUTTRESS
15. 2 3/8" BUTTRESS TEG.
16. X-OVER 2 3/8" BUTT. X EUEB.
17. STINGER COLLET
18. 1 1/4" 10rd IS TEG.
19. X-OVER 10rd IS 1 1/4" x 10rd

NOTE*: TO BE LOCATED BELOW
BOTTOM Drinkard PERFS

7", 26 1/2" K-55 CS4 @ 6825'
W/1660 SX.