

Submit 3 Copies To Appropriate District Office  
 District I  
 1625 N. French Dr., Hobbs, NM 88240  
 District II  
 811 South First, Artesia, NM 88210  
 District III  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV  
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

Form C-103  
 Revised March 25, 1999

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

<b>WELL API NO.</b> 30-025-10039
<b>5. Indicate Type of Lease</b> STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
<b>6. State Oil &amp; Gas Lease No.</b>
<b>7. Lease Name or Unit Agreement Name:</b> Sticher, E.A
<b>8. Well No.</b> 2
<b>9. Pool name or Wildcat Paddock</b> Paddock
<b>10. Elevation (Show whether DR, RKB, RT, GR, etc.)</b>

**SUNDRY NOTICES AND REPORTS ON WELLS**  
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

**1. Type of Well:**  
 Oil Well  Gas Well  Other

**2. Name of Operator**  
 Texaco Exploration & Production, Inc.

**3. Address of Operator**  
 P. O. Box 3109, Midland, TX 79702

**4. Well Location**  
 Unit Letter L : 1980 feet from the South line and 660 feet from the West line  
 Section 4 Township 22S Range 37E NMPM Lea County

**11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data**

<b>NOTICE OF INTENTION TO:</b>		<b>SUBSEQUENT REPORT OF:</b>	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

**12. Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- Set 5" CIBP @ 5175', (Paddock) Spot 25 Sx plug 5175'-4900' WOC Tag
- Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL
- Cut 5" Csg @ 3900', L/D 5" Csg.
- Spot 90 Sx plug 3950'-3400' (Queen, 7" shoe) WOC Tag.
- Perf 6 holes @ 2800', Sqz 75 Sx plug 2800'-2500' (Yates, B-Salt) WOC Tag
- Perf 6 holes @ 1210', Sqz 75 Sx plug 1210'-1000' (8 5/8" shoe, T-Salt) WOC Tag
- Perf 6 holes @ 180', Circ 100 Sx Cmt 180'-Surf (7" X 8 5/8" X 16 shoe) WOC Tag
- Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. T. Corbett TITLE FACILITY ENGINEER DATE 9/24/01  
 Type or print name JAMES T. CORBITT Telephone No. 915-688-4438  
 (This space for State use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE SEP 26 2001  
 Conditions of approval, if any:


102

mlp

# PLUGGING & ABANDONMENT WORKSHEET (3 STRING CSNG)

OPERATOR TEXACO Exploration & Production  
 LEASENAME STICHER, E. A

WELL # 2  
 SECT 4 TWN 22 S RNG 37 E  
 FROM 1980 NSL 660-480 EWL  
 TD: 6580 FORMATION @ TD Drinkaed  
 PBDT: 6508 FORMATION @ PBDT Paddock

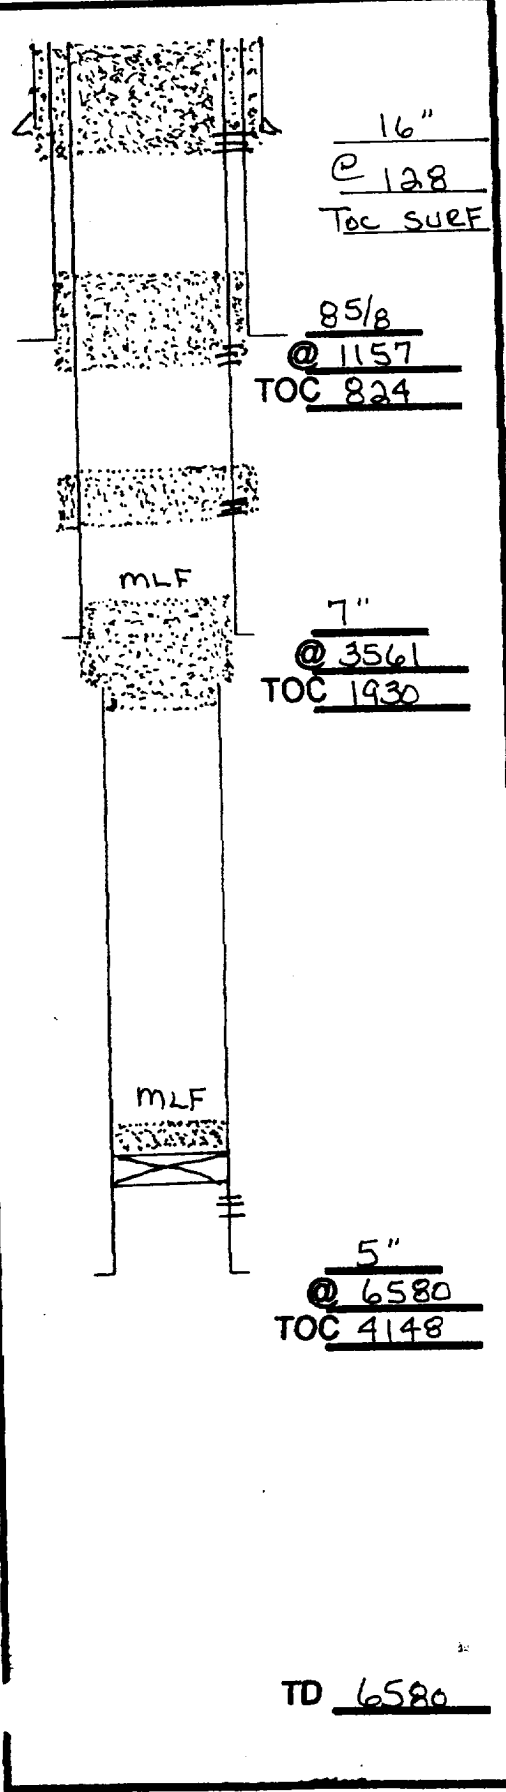

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	16	128	SURF	CIRC
INTMED 1	8 5/8	1157	824	CALC
INTMED 2	7"	3561	1930	CALC
PROD	5"	6580	4148	CALC
	SIZE	TOP	BOT	TOC DETERMINED BY
LINER 1				
LINER 2				
	CUT & PULL @		TOP - BOTTOM	
INTMED 1			PERFS	5224 - 5270
INTMED 2			OPENHOLE	-
PROD				

**\* REQUIRED PLUGS DISTRICT I \***

RUTLER (ANHYD)	
YATES	
QUEEN	
GRAYBURG	
SAN ANDRES	
CANTAN BEEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BREBET CANYON	
BONE SPRING	
GLORGETA	
BLINNEY	
TUBB	
ORNKARD	
ABO	
WC	
PENK	
STRAWN	
ATOKA	
MOOREW	
AGEE	
DEVOREAN	

PLUG	TYPE PLUG	SACKS CMNT	DEPTH
EXAMPLE			
PLUG #1	OH	25 SXS	9650'
PLUG #2	SHOE	50 SXS	8700-8800'
PLUG #5	CIBP/35'		5300'
PLUG #3	CIBP	25 SXS	5300'
PLUG #4	STUB	50 SXS	4600-4700'
PLUG #6	RETNR SQZ	200 SXS	400
PLUG #7	SURF	10 SXS	0-10'
PLUG #1	CIBP	25 SX	5175-4900
PLUG #2	7" SHOE	90 SX	3950-3400
PLUG #3	YATES	75 SX	2800-2500
PLUG #4	8 5/8 S	75 SX	1210-1000
PLUG #5	16" S	100 SX	180-SURF
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			