

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS


(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐ other ☐
2. NAME OF OPERATOR
TEXACO Inc.
3. ADDRESS OF OPERATOR
P.O. Box 728, Hobbs, New Mexico 88240
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980' FNL & 660' FWL
AT TOP PROD. INTERVAL: (Unit Letter 'E')
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

5. LEASE
10-033706 (a)
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
C.P. Falby A Federal
9. WELL NO.
4
10. FIELD OR WILDCAT NAME
Drinkard
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 8, T-22-S, R-37-E
12. COUNTY OR PARISH
Lea
13. STATE
New Mexico
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
3429' (DF)

REQUEST FOR APPROVAL TO: SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF ☐ ☐
FRACTURE TREAT ☐ ☐
SHOOT OR ACIDIZE ☐ ☐
REPAIR WELL ☐ ☐
PULL OR ALTER CASING ☐ ☐
MULTIPLE COMPLETE ☐ ☐
CHANGE ZONES ☐ ☐
ABANDON* ☐ ☐
(other) OF: Squeeze Eumont & Penrose Skelly Zone- Addl. Perfs in Drinkard Zone

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

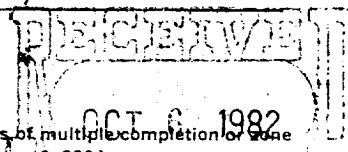

OIL & GAS
U.S. GEOLOGICAL SURVEY
HOSWELL, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*
1. Bigged up. Killed Eumont & Penrose Skelly Zones & pull tubing. Kill Drinkard Zone & install BOP. Pull tubing.
 2. Set RBP in Drinkard String @ 3597'.
 3. Set Cement retainer @ 3422' in Eumont string. Squeeze Eumont perfs. 3473'-3566- W/300 Sx. Class 'H' Cement containing 2% CaCl. WOC., DOC.
 4. Tested 7 5/8" Csg to 1000# for 30 minutes, 3:00-3:30 PM, 7-17-82. Tested OK. Eumont Zone P&A 7-14-82.
 5. Set RBP in Penrose Skelly string @ 3826'.
 6. Set Cement retainer @ 3605'. Cement Squeeze csg perfs 3672'-3733' W/250 Sx Class H Cement. Penrose Skelly P&A, 7-20-82. DOC. Tested to 1000# for 30 minutes, 4:45-5:15 PM, 7-22-82. Tested OK.
 7. Perforate 4 1/2" Csg liner in Drinkard W/2-JSPF @ 6366' 72,78 87,91,98,6403' 08,25,31,36,40,42, & 6466'.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Peter W. Chester TITLE Asst. Dist. Mgr. DATE 10-4-82

(This space for Federal or State office use)

APPROVE (Onlg. Sgd.) PETER W. CHESTER TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

711

RECEIVED

JAN 18 1983

C.C.D.
HOBBS OFFICE