

Submit 3 Copies To Appropriate District Office

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-12118
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Dollie Ballenger
8. Well No. 1
9. Pool name or Wildcat Blinebry S. Brunson Drk ABO

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well Gas Well Other

2. Name of Operator
Texaco Exploration & Production, Inc.

3. Address of Operator
P. O. Box 3109, Midland, TX 79702

4. Well Location
Unit Letter M : 660 feet from the South line and 660 feet from the West line
Section 17 Township 22-S Range 38-E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- Set 5 1/2" CIBP @ 5660', Spot 25 Sx plug 5660'-5460' (Blinebry) WOC Tag
- Displace hole w/MLF 9.5# Brine w/25# gel P/BBL
- Spot 25 Sx plug 4000'-3800' (Queen)
- Cut 5 1/2" Csg. @ 2950', L/D Csg.
- Spot 75 Sx plug 2950'-2600' (8 5/8" shoe, Yates, B-Salt, Stub) WOC Tag
- Spot 50 Sx plug 1500'-1300' (T-Salt) WOC Tag.
- Spot 50 Sx plug 410'-200' (13 3/8" shoe) WOC Tag.
- 10 Sx Surf, Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James T. Corbitt TITLE FACILITY ENGINEER DATE 10/16/07
 Type or print name JAMES T. CORBITT Telephone No. 915 688-4438


APPROVED BY _____ TITLE _____ DATE _____
 Conditions of approval, if any:

32

PLUGGING & ABANDONMENT WORKSHEET (3 STRING CSNG)

OPERATOR TEXACO EXPLORATION & PRODUCTION
 LEASENAME DOLLIE BALLINGER

WELL # 1
 SECT 17 TWN 22-S RNG 38-E
 FROM 660 NSL 660 EWL
 TD: 7200 FORMATION @ TD Drinkard
 PBTD: _____ FORMATION @ PBTD Blinebery

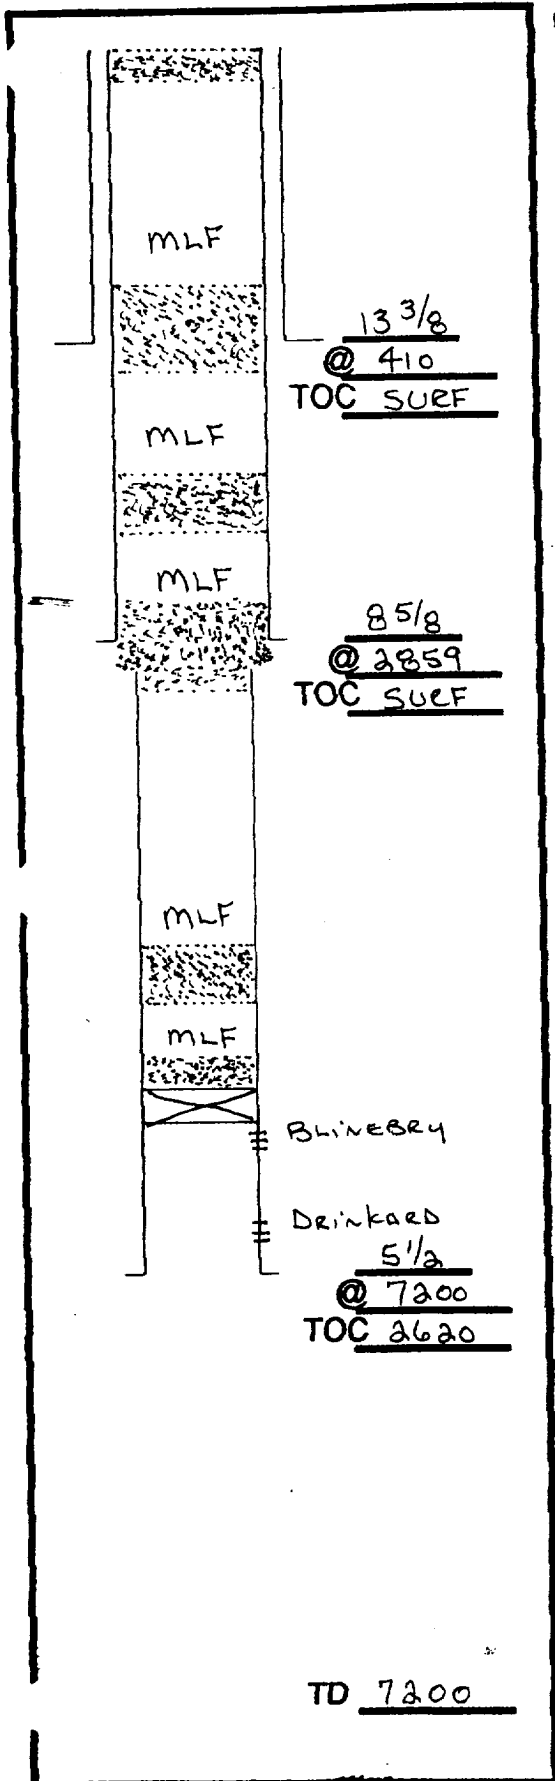

	SIZE	SET @	TOC	TOC DETERMINED BY	
SURFACE	13 3/8	410	SURF	Circ	
INTMED 1	8 5/8	2859	SURF	Circ	
INTMED 2					
PROD	5 1/2	7200	2620	CALC	
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					
CUT & PULL @			TOP - BOTTOM		
INTMED 1			PERFS	5718 - 5905	
INTMED 2			OPENHOLE	6800 - 7158	
PROD	2900				

* REQUIRED PLUGS DISTRICT I

RUSTLER (ANHYD)	*
YATES	
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPTAN REEF	*
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUBBY CANYON	
BONE SPRING	
OLORIETA	*
BLINEBERY	
TUBS	
DRINKARD	
ABO	
WC	
PENN	
STRAWN	
ATOKA	
MORROW	
BOSS	
DEVONIAN	

PLUG	TYPE PLUG	SACKS CMNT	DEPTH
EXAMPLES			
PLUG #1	OH	25 SXS	9850'
PLUG #2	SHOE	50 SXS	8700-8800'
PLUG #3	CIBP/35'		5300'
PLUG #3	CIBP	25 SXS	5300'
PLUG #4	STUB	50 SXS	4600-4700'
PLUG #6	RETNR SQZ	200 SXS	400
PLUG #7	SURF	10 SXS	0-10'
PLUG #1	CIBP		5660'
PLUG #2	BLINEBERY	25 SX	5660-5460
PLUG #3	QUEEN	25 SX	4000-3800
PLUG #4	8 5/8	75 SX	2950-2600
PLUG #5	T-SALT	50 SX	1500-1300
PLUG #6	13 3/8 S	50 SX	410-200
PLUG #7	SURF	10 SX	10' - SURF
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			