

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

50. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
51. State Oil & Gas Lease No.	

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> <small>(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO CLEAN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT - "A" (FORM C-101) FOR SUCH PROPOSALS.)</small>		
1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Atlantic Richfield Company		8. Firm or Lease Name John P. Combest WN
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240		9. Well No. 1 3
4. Location of Well UNIT LETTER <u>A</u> <u>760</u> FEET FROM THE <u>North</u> LINE AND <u>600</u> FEET FROM THE <u>East</u> LINE, SECTION <u>35</u> TOWNSHIP <u>23S</u> RANGE <u>36E</u> N.M.P.M.		10. Field and Pool, or Wildcat Langlie Mattix 7RO
15. Elevation (Show whether DF, RT, GR, etc.) 3334' GR		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	LM7RO zone only	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	
OTHER <input type="checkbox"/>		OTHER <input type="checkbox"/>	


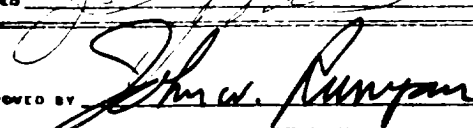
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 3571', PBD 3548'. Present perms 3486-3534'. This well has been shut in because the well is uneconomical to produce. Propose to plug the 7Rivers Queen zone & recomple to the Jalmat Gas in the following manner:

1. Rig up, install BOP & POH w/completion assy.
2. Run GR-Corr log PBD to 2800'.
3. RIH w/cmt retr, set retr @ 3450'.
4. RIH w/tbg, sting into retr & squeeze perms 3486-3534' w/100 sx LWL cmt followed by 50 sx Cl C cmt cont'g 5#/sk sd. POH w/stinger & tbg.

Note: Recompletion to Jalmat Gas zone reported separately on Form C-101.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

DESIGNED 	TITLE <u>Dist. Drlg. Supv.</u>	DATE <u>11/1/76</u>
APPROVED BY 	TITLE _____	DATE <u>NOV 4 1976</u>
CONDITIONS OF APPROVAL, IF ANY:		