


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

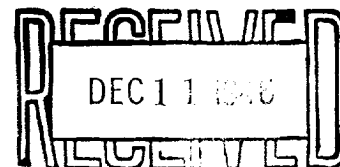

HOBBS OFFICE

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	X		

December 10, 1946

Date

Hobbs, New Mexico

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO.

Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the _____

Gulf Oil Corporation**G. E. Cooper**Well No. **1** in the _____

Company or Operator

Lease

SW SWof Sec. **11**T. **24-S**R. **36-E**

N. M. P. M.,

Cooper

Field,

Lea

County.

The dates of this work were as follows: **November 10, 1946 to November 16, 1946**Notice of intention to do the work was (~~was not~~) submitted on Form C-102 on **March 4,** 19 **46**and approval of the proposed plan was (~~was not~~) obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

Set Baker cement retainer at 3390', squeezed 48 sacks cement, perforated and tested 3200' - 3325', set retainer at 3194', squeezed 25 sacks of cement, perforated and tested 3100' - 3155'. Well snubbed dry, no oil, gas, or water. Filled hole with 40 sacks of Baroco mud, shot 5-1/2" casing off at 2700', recovered 2704' of 5-1/2" casing, left 797' of 5-1/2" casing in hole. Set 15 sack cement plug at 2700'. Shot 7-5/8" casing off at 400'. Recovered 393' of 7-5/8" casing, left 2514' of 7-5/8" casing in hole. Set 10 sack cement plug at 400'. Left 246' of 10-3/4" pipe in hole, set 10 sack plug at surface with 4' x 4" marker.

Witnessed by Glenn Stach	Gulf Oil Corporation	Foreman
Name	Company	Title

Subscribed and sworn before me this _____

I hereby swear or affirm that the information given above is true and correct.

10th da. of **December**, 19 **46**Name **E. J. Gallagher**Position **District Superintendent**Representing **Gulf Oil Corporation**
Company or OperatorMy commission expires **Oct. 24, 1949**Address **Box 1667, Hobbs, New Mexico**

Remarks:

APPROVED

Date **DEC 11 1946**

Roy Yurroughs
Oil & Gas Inspector

Title