

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

811 South First, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

DISTRICT IV

2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

2040 South Pacheco
Santa Fe, NM 87505

FORM C-103
Revised March 25, 1999

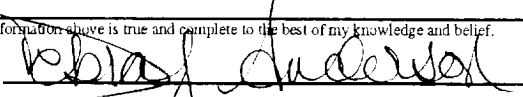
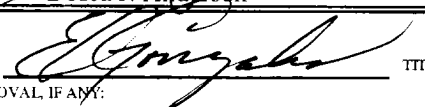
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-10704
1. Type of Well: <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		5. Indicate Type of Lease <input type="checkbox"/> STATE <input checked="" type="checkbox"/> FEE
2. Name of Operator Anache Corporation		6. State Oil & Gas Lease No.
3. Address of Operator 2000 Post Oak Blvd., Ste. 100, Houston, Texas 77056-4400		7. Lease Name or Unit Agreement Name Skelly Penrose 'A' Unit
4. Well Location: Unit Letter F : 1980 Feet From The North Line and 1980 Feet From The West Line Section 10 Township 23S Range 37E NAIPM Lea County		8. Well No. 50
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3284' GR		9. Pool name or Wildcat Langlie-Mattix; 7 Rvrs-Q-Grayburg (37240)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO: <input type="checkbox"/> Perform Remedial Work <input type="checkbox"/> Plug and Abandon <input type="checkbox"/> Temporarily Abandon <input type="checkbox"/> Change Plans <input type="checkbox"/> Pull or Alter Casing <input type="checkbox"/> Other	SUBSEQUENT REPORT OF: <input type="checkbox"/> Remedial Work <input type="checkbox"/> Altering Casing <input type="checkbox"/> Commence Drilling Operations <input checked="" type="checkbox"/> Plug and Abandonment <input type="checkbox"/> Casing Test and Cement Job <input type="checkbox"/> Other

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

8/2/00 MIRU. Rig up wireline. Run in hole w/ wireline. Perforate @ 1225'. Pull out of hole w/ wireline. Run in hole w/ 7" cement retainer and set @ 1125'. Pull out of hole w/ wireline.

8/3/00 Run in hole w/ coiled tubing & stinger. Sting into 7" cement retainer @ 1125'. Pressure up to 1300# per square inch and held. Called Buddy Hill with Oil Conservation Division and plugged out well per Buddy Hill as follows. Pull out of retainer, mix and pump mud from 1125' to surface. Spot 35 sx of Class "C" neat on top of cement retainer. Pull up hole to 175', mix and pump 100 sx Class "C" neat from 175' to surface. Install P&A marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.			
SIGNATURE		TITLE	Sr. Engineering Technician
DATE	9/25/00	TELEPHONE NO.	713-296-6338
TYPE OR PRINT NAME Debra J. Anderson			
(This space for State Use)			
APPROVED BY		TITLE	J. Gonzalez
DATE	3-5-01		
CONDITIONS OF APPROVAL, IF ANY:			

200

GWV

8