

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on
reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		5. LEASE DESIGNATION AND SERIAL NO. 1C 01137
2. NAME OF OPERATOR Gulf Oil Corporation		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Box 980, Kermit, Texas 79745		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 460' from N rth Line, 660' from East Line		8. FARM OR LEASE NAME C. E. Blumeyer
14. PERMIT NO.		9. WELL NO. 43
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3309' RKB		10. FIELD AND POOL, OR WOODS
		11. SEC., T., R. OR B.M. AND SURVEY AREA 21-23E 37E
		12. COUNTY OR PARISH Lebanon New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☒	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	(Other) ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and casing points pertinent to this work.)*

It is proposed to perforate and frac additional Blumeyer pay. Pull tubing and set retrievable bridge plug at 5510'. Spot 500 gallons 15% NE acid. Perforate 5381-83' and 5428-30' with 4 JHPs. Acidize perforations with 2,000 gallons 7-1/2% NE acid. Frac down casing with 14,000 gallons gelled brine and 13,000 pounds 20-40 mesh sand in two stages of 1,000 gallons pad, 6,000 gallons frac with 1 1/2 pounds sand per gallon. Stages to be separated with 500 gallons 15% NE acid and 8 - 1" RCN ball sealers. Recover bridge plug and place well on production. Work to start on approval.

18. I hereby certify that the foregoing is true and correct


ORIGINAL
SIGNED BY: **H. F. SWANNACK** TITLE: **Area Production Manager** DATE: **August 26, 1969**

(This space for Federal or State office use)

APPROVED BY: _____ TITLE: _____ DATE: _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

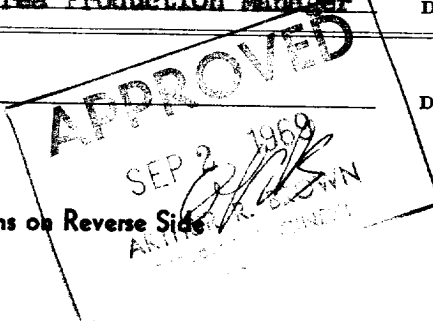

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, of all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; kind or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963 O-685229
GPO 8 37-499 847-851