

UNITED STATES DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY  
N. M. OIL & GAS COMMISSION  
P. O. Box 1950  
HOBBS, NEW MEXICO 88240

Form approved.  
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. NM 18644	
2. NAME OF OPERATOR HNG OIL COMPANY		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR P. O. Box 2267, Midland, Texas 79702		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FSL & 600' FWL, Sec. 9		8. FARM OR LEASE NAME Wilson 9 Federal	
14. PERMIT NO.		9. WELL NO. 1	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 2968' GR		10. FIELD AND POOL, OR WILDCAT Sioux Tansill Yates SR	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 9, T26S, R36E	
		12. COUNTY OR PARISH Lea	
		13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF: 6-30-82	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	


(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

8-3-82 - 5-1/2" Pengo cement retainer set at 3264'; pump 12 bbls 10 ppg brine into formation; circ the hole w/88 bbls 10 ppg brine gel mud; sting into the retainer and squeeze perfs 3360'-3673' w/90 sx. C1 H cement, leaving 25' cement on top of retainer.

8-4-82 - Perf 4 .38" holes at 1400', circ w/41 bbls 10 ppg brine; mix and pump 40 sx. Class 1 w/2% CaCl<sub>2</sub>; displ top of rubber plug to 1261; 2-1/2 hours WOC; 1/2 hour TIH to 1285'; tag top of plug. Mix and spot 15 sx. C1 H from 60' to surface. Cut off head, weld on plate and dry-hole marker; cleaned up location.

No casing recovered.

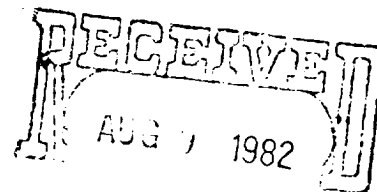

OIL & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED Betty Gildon TITLE Regulatory Analyst DATE 8/5/82

(This space for Federal or State Office Use)  
(Orig. Sgd.) PETER W. CHESTER  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_ DATE \_\_\_\_\_

FEB 9 1983  
FOR  
JAMES A. GILLHAM  
DISTRICT SUPERVISOR

\*See Instructions on Reverse Side