

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT TO: INDIAN
(Other instructions on re-
verse side)

Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. NM 18644
2. NAME OF OPERATOR HNG OIL COMPANY		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Box 2267, Midland, Texas 79702		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FSL & 1980' FWL, Sec. 9, T26S, R36E		8. FARM OR LEASE NAME Wilson 9 Federal
14. PERMIT NO.		9. WELL NO. 4
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 2958' GR		10. FIELD AND POOL, OR WILDCAT Sioux Tansill Yates SR
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 9, T26S, R36E
		12. COUNTY OR PARISH Lea
		13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF: 6-9-82

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6-29-82 - Set Cement retainer at 3168'; pump 12 bbls 10 ppg brine into formation; circ the hole w/90 bbls 10 ppg gel mud; sting into the retainer and squeeze perfs 3270' - 3629' w/ 90 sx Class H cement; pull out of ret and leave 25' cement on top of retainer.

6-30-82 - Cut and recovered 1990' of 5-1/2" 14# casing.

Mix and spot 60 sx. C1 H cement 2% CaCl₂ from 2048' - 1920'. tagged cement plug at 1938'.

Circ. hole w/96 bbls 10 ppg salt mud; mix and spot 70 sx. C1 H cement from 1472' - 1372'.

Mix and spot 25 sx. 90' to surface.

7-1-82 - Cut off head, weld on plate and dry-hole marker; cut off anchor; clean up location.

18. I hereby certify that the foregoing is true and correct

SIGNED

Betty Gildon

TITLE Regulatory Analyst

DATE 7/2/82

(This space for Federal approval only)

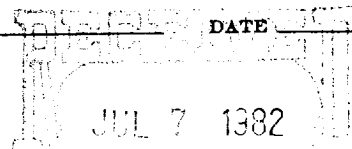
APPROVED BY (Signature) PETER W. CHESTER
CONDITIONS OF APPROVAL, IF ANY:

FEB 9 1983

FOR

JAMES A. GILLHAM
DISTRICT SUPERVISOR

*See Instructions on Reverse Side

U.S. GEOLOGICAL SURVEY
TOSWELL, NEW MEXICO