

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-33784
5. Indicate Type of Lease STATE FEE X
6. State Oil & Gas Lease No. 162683
7. Lease Name or Unit Agreement Name: Skelly Penrose "A" Unit
8. Well No. 81
9. Pool name or Wildcat Langlie Mattix 7RV Queen
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 33616GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well Gas Well X Other

2. Name of Operator
Gruy Petroleum Mgt.

3. Address of Operator
P.O. Box 140907, Irving, TX. 75014-0907

4. Well Location
Unit Letter A- 1320 feet from the North line and 114 feet from the East line
Section 04 Township 23S Range 37E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK PLUG AND ABANDON ☐
TEMPORARILY ABANDON CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Temporarily Abandon X

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Gruy Petroleum Mgt. Respectfully request approval of Temporarily abandonment of the above mention well. Attached is the MIT psi chart conducted on 7-1-02.

Rih with 4.34" Gauge ring, tag @ 3006' GL, Call NMOCD, received conformation from Mr. Gary Wink to set CIBP @ 3000. Rih with 4.24" CIBP set @ 3005' GL, spot 35' class H cement. Load csg. With weighted corrosion inhib. Run MIT 7-1-02, Pressure up to 500# at start of 30 Min. test, end pressure 498 #. Note: before CIBP was set well had 1/2 BPM water inflow.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE: Reggie Reston TITLE: Production Supt. DATE: 7-01-02

Type or print name Reggie Reston

Telephone No. 505-393-2358

(This space for State use)


APPROVED BY

ORIGINAL SIGNED BY

Conditions of approval, if any:

GARY W. WINK

OC FIELD REPRESENTATIVE II/STAFF MANAGER

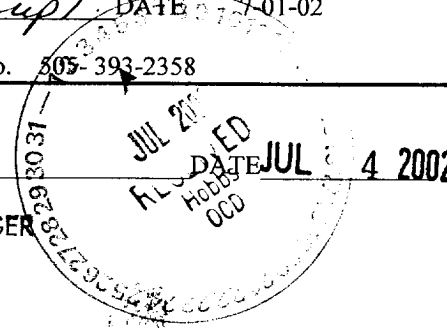

This Approval of Temporary
Abandonment Expires 7/3/07

J
C
S