


WELL:	Skelly Penrose -A- Unit # 81
POOL:	Langlie Mattix; 7 Rvrs-Q-Grayburg Pool (37240)
LOCATION:	1320' FNL & 114' FEL
	Unit A, Sec 4, T-23S, R-37E
COUNTY/STATE:	Lea County, New Mexico

Current Completion

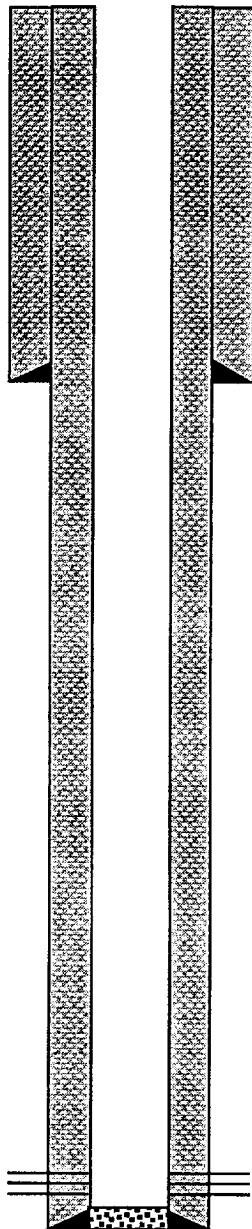


TD @ 3750'
PBTD @ 3706'

12-1/4" Hole
9-5/8" 32# H-40 CSA 1150'
Cement w / 550 sx
Circulated to Surface

7 Rvrs-Queen-Grayburg Perfs:
3517' - 3682'

8-3/4" Hole
5-1/2" 17# K-55 CSA 3750'
Cement w / 1700 sx
Circulated to Surface

P&A Proposal

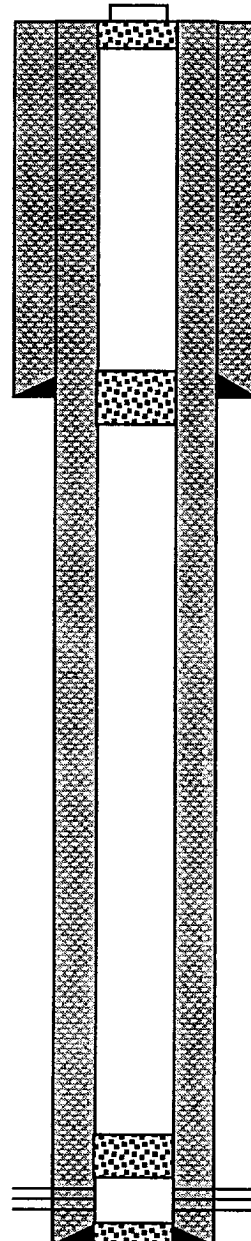

TD @ 3750'
PBTD @ 3706'

Install P&A Marker
Surface Plug - Spot cement
plug @ 50' to Surface w/
10 sx

Cement Plug 1100' - 1230'
w/ 35 sx - Tag top of cement

Spot cement plug @ 3475'
w/ 25 sx - Tag top of cement

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

811 South First, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

DISTRICT IV

2040 South Pacheco, Santa Fe, NM 87505

OIL CONSERVATION DIVISION

2040 South Pacheco
Santa Fe, NM 87505

WELL API NO.

30-025-33784

5. Indicate Type of Lease

☐ STATE

☒ FEE

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Skelly Penrose A Unit

8. Well No.

81

9. Pool name or Wildcat

Langlie-Mattix; 7 Rvrs-Q-Grayburg (37240)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:

☒ OIL WELL

☐ GAS WELL

☐ OTHER

2. Name of Operator

Anache Corporation

3. Address of Operator

2000 Post Oak Blvd., Ste. 100, Houston, Texas 77056-4400

4. Well Location

Unit Letter A : 1320 Feet From The North Line and 114 Feet From The East Line
Section 4 Township 23S Range 37E NMPM Lea County

10. Elevation (Show whether DP, RKB, RT, GR, etc.)

3316' GR

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

☐ Perform Remedial Work

☒ Plug and Abandon

☐ Temporarily Abandon

☐ Change Plans

☐ Pull or Alter Casing

☐ Other

SUBSEQUENT REPORT OF:

☐ Remedial Work

☐ Altering Casing

☐ Commence Drilling Operations

☐ Plug and Abandonment

☐ Casing Test and Cement Job

☐ Other

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1.) Spot cement plug @ 3475' w/ 25 sx - Tag top of cement

———— 25 SX @ 2474' to 2374' BASE of SALT

2.) Spot cement plug @ 1100' - 1230' w/ 35 sx cement - Tag top of cement

3.) Spot cement plug @ 50' to surface w/ 10 sx

4.) Install P&A marker

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Debra J. Anderson
Debra J. Anderson

TITLE

Sr. Engineering Technician

DATE

9/25/00

TYPE OR PRINT NAME

Debra J. Anderson

TELEPHONE NO.

713-296-6338

(This space for State Use)

APPROVED BY

TITLE

DATE

OCT 6 2000

CONDITIONS OF APPROVAL, IF ANY: