

Form 8-381a
(March 1942)


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office LC032592

Lease No. 41682

Unit _____

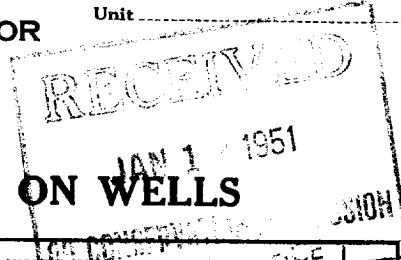

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 15, 1951

Well No. 5 is located 990 ft. from N line and 990 ft. from E line of sec. 3

SE4 of Sec 3 25-S 37-E 14-PM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Lan. Lic. Mattix Lee New Mex. Co.
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3130 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

TD - 3480 - Line PSTD: 3473'

Before shooting this well pumped 20 bbls oil in 6 hrs on 9-10-50.

Shot well 3242-3480 with 498 gals shock oil on 10-4-50. Swabbed 8 bbls oil in 24 hrs. After cleaning out. Loaded hole with 16 cu. yds. of gravel & ran 271' 4 1/2" insert liner (5' blank, next 83' slotted with 4-1/6" x 6" slots per ft.) Drove liner to 3478 & cleaned out inside liner to 3473. Ran 2" Tubing to 3463. On 1-3-51, well pumped 25 bbls oil & 37 bbls water in 24 hrs.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The Texas Company

Address Box 1270, Midland, Texas

By J. H. New

Title Dist. Supt.