

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC-032630 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
A. B. Contes "C"

9. WELL NO.
10

10. FIELD AND POOL, OR WILDCAT
Justis Blinebry-Ellenburger

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
Sec. 24, T25S, R37E

12. COUNTY OR PARISH
Lea

13. STATE
New Mexico

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR
Tidewater Oil Company

3. ADDRESS OF OPERATOR
Box 249, Hobbs, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1980' FNL & 2080' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, CR, etc.)
3088 DF

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

SUBSEQUENT REPORT OF:

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well is a dual Blinebry-Ellenburger oil producer. The Blinebry zone was recently perforated with one 3/8" hole each @ 5242, 49, 55, 63, 90, 96, 5319, 67, 86, 99, 5437 and 5445'. An Otis LCH dual packer was set at 5327'. Perfs above packer have not been tested. It is proposed to set tubing plug in Blinebry tubing string, blanking off all Blinebry perforations below Otis LCH packer at 5327', and open sliding sleeve above LCH packer, and treat upper Blinebry perforations, 5242-5319' with 55 gals. Nutro Prep mixed in 10 barrels water, swab and test. Pull tubing plug. May close sliding sleeve at end of job depending upon GOR.

18. I hereby certify that the foregoing is true and correct

SIGNED Original Signed By

TITLE Area Supt.


DATE 1-14-63

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

*See Instructions on Reverse Side

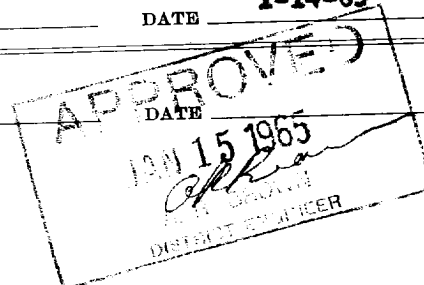

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.