

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on
reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC 032650 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

A. B. Conates C

9. WELL NO.

20

10. FIELD AND POOL, OR WILDCAT

Justis Ellenburger-McKee

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 24, T25S, R37E

12. COUNTY OR PARISH

Lea

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Tidewater Oil Company

3. ADDRESS OF OPERATOR

Box 249, Hobbs, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

990' FNL and 990' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3080 DF

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☒

PULL OR ALTER CASING

☐
☐
☐
☐

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

☐
☐
☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

The Ellenburger zone in this well is completed in open hole 7626' to 7750'. Latest tests indicate an increase in gas from this zone. It is proposed to install a formation packer to shut off the gas section as follows:

Pull both tubing strings. (McKee & Ellenburger). If it is necessary to block the McKee, run a Baker Anchor Type DR plug on wire line and set in Model D at 7390'. Run in hole with tubing and DR retrieving tool, block McKee zone with oyster shells in jelled carrying material. Retrieve DR plug. Run retrieving and milling tool and mill up Baker Model D at 7390'. Run Lynes open hole test packer, set approximately 7683'. Swab and GOR test. If GOR is high, re-set packer at 7724', swab and test. Kill well and pull Lynes packer. If test is successful, run Lynes Prod. packer, set at same depth as was the successful test, also, run Baker Model E packer and Baker parallel anchor on long string, anchor to be set at 7200', Model E at 7400'. Swab test long string before running short string, Lynes packer may not have good seat. Put BP valve in long string and run short string; latch into anchor. Swab both zones to flowing.

18. I hereby certify that the foregoing is true and correct

Original Signed By

SIGNED

G. L. WADE

TITLE

Area Supt.

DATE

2-25-65


(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

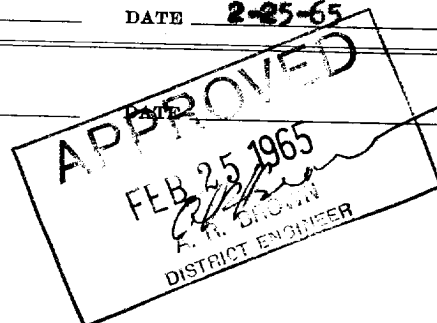

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.