

NO. OF COPIES RECEIVED	
DISTRIBUTION	
DATE	
FILE	
J.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS
DO NOT USE THIS FORM FOR NOTICES TO WELL OR TO REPORT ON WELLS IN A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL (Form C-101) FOR SUCH PURPOSES.

OIL WELL ☒ Dual GAS WELL ☐ OTHER ☐

Name of Operator
Atlantic Richfield Company

Address of Operator
P. O. Box 1710, Hobbs, New Mexico 88240

Location of Well
UNIT LETTER **D** **990** FEET FROM THE **West** LINE AND **660** FEET FROM
THE **North** LINE, SECTION **24** TOWNSHIP **25S** RANGE **37E** N.M.P.M.

13. Elevation (Show whether DF, RT, GR, etc.)
3082.7' GR

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

7. Unit Agreement Date

8. Farm or Lease Name
Wimberly WN

9. Well No.
6

10. Field and Pool, or without
Justis Tubb Drkd
Justis Fusselman

12. County
Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ REMEDIAL WORK ☐ ALTERING CASING ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐ OTHER ☒ **Temporarily abandon Justis Tubb Drkd zone**

SUBSEQUENT REPORT OF:

CASING TEST AND CEMENT JOBS ☐ OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 7090', PBD 6824'. Presently completed as dual oil-oil well in the Justis Tubb Drkd perms 5670-5971' & the Justis Fusselman perms 6709-6821'. The Justis Tubb Drkd zone will not produce by gas lift & was shut in on 11/02/76. Propose to temporarily abandon Justis Tubb Drkd zone in the following manner:


1. Rig up, kill well, install BOP & POH w/completion assy.
2. RIH w/locator seal assy on approx 1120' of 2-3/8" OD EUE tbg, Baker FH pkr & on-off tool on 3 1/2" OD EUE tbg. Circ hole w/treated fresh water & locate seal assy in DP pkr @ 6662', set Baker FH pkr @ approx 5530', release 3 1/2" tbg from on-off tool & POH w/3 1/2" tbg. TA Justis Tubb Drkd perms 5670-5971' by isolating w/pkrs. RIH w/completion assy for Justis Fusselman zone & return to production as single oilwell.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Dist. Drlg. Supt. DATE 12/22/76

APPROVED BY [Signature] TITLE DATE

CONDITIONS OF APPROVAL, IF ANY:

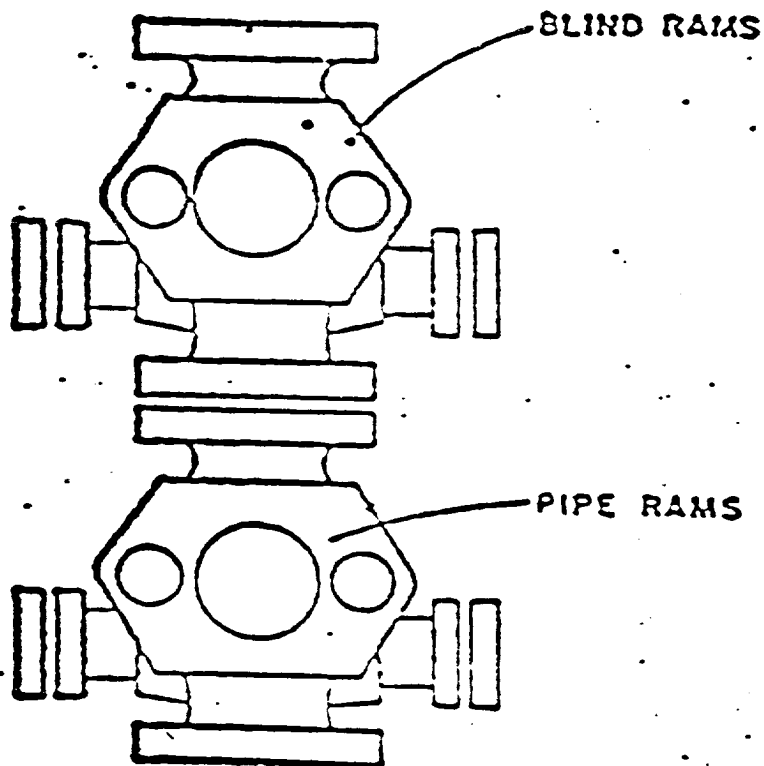

ATLANTIC RICHFIELD COMPANY
Blow Out Preventer Program

Lease Name Wimberly WN

Well No. 6

Location 990' FWL & 660' FNL
Sec 24-25S-37E, Lea County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.