

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-12299	
5. Indicate Type of Lease STATE ☒ FEE ☐	
6. State Oil & Gas Lease No. B-9311	
7. Lease Name or Unit Agreement Name: New Mexico "J"	
8. Well No. 5	
9. Pool name or Wildcat Blinebry	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other	
2. Name of Operator Chevron USA, Inc.	
3. Address of Operator 15 Smith Rd. Midland, Tx 79705	
4. Well Location Unit Letter <u>L</u> : <u>1980</u> feet from the <u>south</u> line and <u>660</u> feet from the <u>west</u> line Section <u>32</u> Township <u>24-S</u> Range <u>38-E</u> NMPM County <u>Lea</u>	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐ OTHER: ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU.
2. RIH Tag 5 1/2 CIBP @ 5395, spot 25sx plug 5395-5195(Blinebry) WOC Tag.
3. Displace hole w/MLF 9.5 # Brine w/25 # Gel P/BBL.
4. Spot 25sx plug 3700-3500(Queen)
5. Spot 60sx plug 3200-2600(9 5/8 shoe, B-salt, Yates) WOC Tag.
6. Spot 25sx plug 1400-1200 (T-salt)WOC Tag.
7. Perf 4 holes @ 300, records show TOC @ surf, no records show that cmt was circ, If well circ. Sqz 100sx plug 300-surf 5 1/2 X 9 5/8 csgs (13 3/8 shoe, surf) WOC Tag.
8. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bleedsue TITLE HES Specialist DATE 12/9/2003
Type or print name G.R. Bleedsue Telephone No. 915-687-7153
(This space for State use)


APPROVED BY GARY M. WINK TITLE DEP. REPRESENTATIVE II/STAFF MANAGER DATE DEC 10 2002
Conditions of approval, if any:

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVRON USA INC.
LEASE NAME MEXICO "I"
WELL # 5

SECT 32 TWN 24-S RNG 38-E
FROM 1980 N/S 660 E/W L
TD 8745 FORMATION @ TD DEVONIAN
PBDT FORMATION @ PBDT BLINEBRY

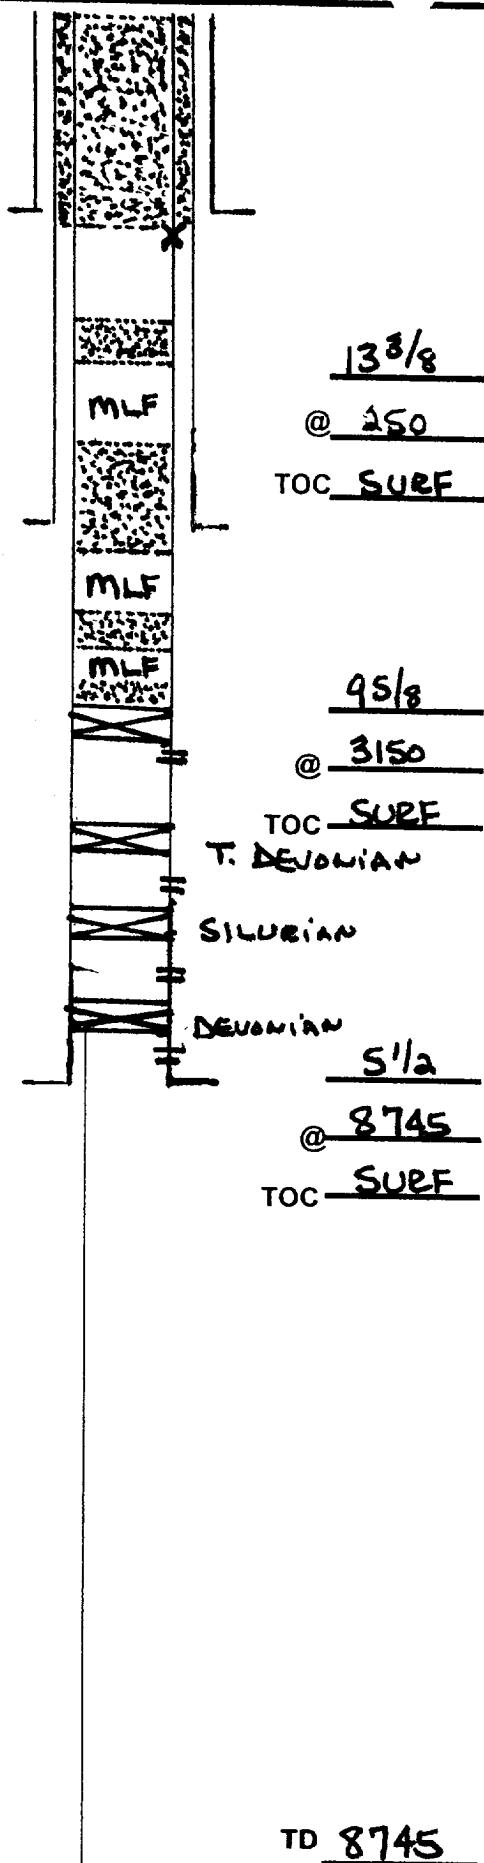

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	13 3/8	250	SURF	Circ
INTMED 1	9 5/8	3150	SURF	CALC
INTMED 2				
PROD	5 1/2	8745	SURF	CALC

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	5413- 5610
INTMED 2	OPENHOLE	
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	BLINEBRY	25	5395
YATES	2	QUEEN	25	3700
QUEEN	3	9 5/8 S	60	3200
GRAYBURG	4	T-SALT	25	1400
SAN ANDRES	5	13 3/8 S	100	300
CAPTAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				