

Submit 3 Copies To Appropriate District

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.

30-025-12324

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

West Dollarhide
Drinkard Unit

8. Well No.

45

9. Pool name or Wildcat

Dollarhide, Tubb, Drinkard

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☐ Other Injection

2. Name of Operator

Chevron USA, Inc.

3. Address of Operator

15 Smith Rd., Midland, TX 79705

4. Well Location

Unit Letter D : 660 feet from the North line and 660 feet from the West line

Section 32

Township 24-S

Range 38-E

NMPM

County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24 hrs prior to MI & RU.
2. Set 7" CIBP @ 6400', spot 25 sx plug 6400'-6300' (Drinkard) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
4. Spot 40 sx plug 3800'-3600' (Queen)
5. Spot 40 sx plug 3200'-3000' (9 5/8" shoe) WOC Tag.
6. Spot 40 sx plug 2600'-2400' (B-Salt, Yates)
7. Spot 40 sx plug 1200'-1000' (T-Salt) WOC Tag
8. Spot 60 sx plug 350'-Surf (13 3/8" shoe surf) WOC Tag
9. Install dry hole marker.



I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

G.R. Bledsoe

TITLE HES Specialist

DATE 12/2/02

Type or print name G.R. Bledsoe

Telephone No. (915) 687-7153

(This space for State use)

APPROVED BY

ORIGINAL SIGNED BY

CHRIS WILLIAMS

TITLE
SUPERVISOR/GENERAL MANAGER

DATE DEC 02 2002

Conditions of approval, if any:

5
C

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME WEST DOWAHEAD DRINKARD UNIT


WELL # 45

SECT 32 TWN 24-S RNG 38-E

FROM 660 N/S L 660 E/W L 660

TD 7020 FORMATION @ TD ABO

PBTD FORMATION @ PBTD DRINKARD

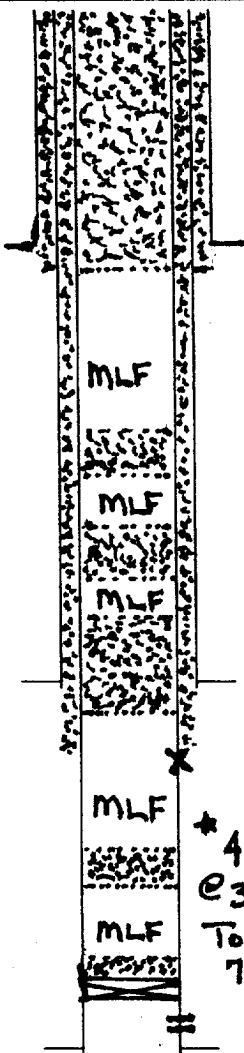

13 3/8
@ 300
TOC SUEF

9 5/8
@ 3150
TOC 950

* 4 1/4 PERF & HOLES
@ 3400' CIRC CMT
To SUEF w/ 7 1/2 SX
7" x 9 5/8 CSQS

7"
@ 7000
TOC 6000

TD 7020

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	13 3/8	300	SUEF	Circ.
INTMED 1	9 5/8	3150	950	T.S.
INTMED 2				
PROD	7"	7000	6000	T.S.

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	6446-6706
INTMED 2	OPENHOLE	
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CBP	25	6400
YATES	2	QUEEN	40	3800
QUEEN	3	9 5/8 S	40	3200
GRAYBURG	4	BT-SALT	40	2600
SAN ANDRES	5	T-SALT	40	1200
	6	13 3/8 S	60	350
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				