

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO. 30-025-21960
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Langlie Mattix Queen Unit
8. Well No. 15
9. Pool name or Wildcat Langlie Mattix 7RV-Qu-Grbg
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3106' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☐ Other **Water Injection Well**

2. Name of Operator
Gruy Petroleum Management Co.

3. Address of Operator
P.O. Box 140907 Irving, Texas 75014-0907

4. Well Location
Unit Letter **F** : **1980** feet from the **North** line and **1730** feet from the **West** line
Section **15** Township **25S** Range **37E** NMPM County **Lea**

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☒ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Gruy Petroleum Management Co., respectfully request approval to Temporarily Abandon this inactive injection well as per the attached procedure:

1. MIRU well service rig. Release pkr., circulate hole and POH w/tubing.
2. RIH with CIBP and set @3370' with 35' cement on top.
3. Test CIBP and casing to 500 psi.
4. RD and move off well. Leave well as TA'd.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Don Aldridge* TITLE Sr. Regulatory Analyst DATE 6-25-2002

Type or print name Don Aldridge Telephone No. 468-4200

(This space for State use)

APPROVED BY GARY W. WINK ORIGINAL SIGNED BY GARY W. WINK TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE JUL 2 2002
Conditions of approval, if any:

GRUY PETROLEUM MANAGEMENT CO.

Langlie Mattix (Queen)
Spud 10/15/69

Langlie Mattix Queen Unit #15

API 30-025-21960

CURRENT COMPLETION

Sherry Reid Carroll 6/21/02


KB: -
DF: -
GL: 3106'

1980' FNL & 1730' FWL
Sec 15, Unit Letter F
T-25-S, R-37-E
Lea County, New Mexico

Casing Strings:
8-5/8" (12-1/4" hole), 20#
@ 1025' w/ 700 sx cmt

Tubing String:
2-7/8" IPC tbg

5-1/2" (7-7/8" hole), 15.5#, J-55
@ 3700' w/ 860 sx cmt
TOC @ 1525' (temp survey)

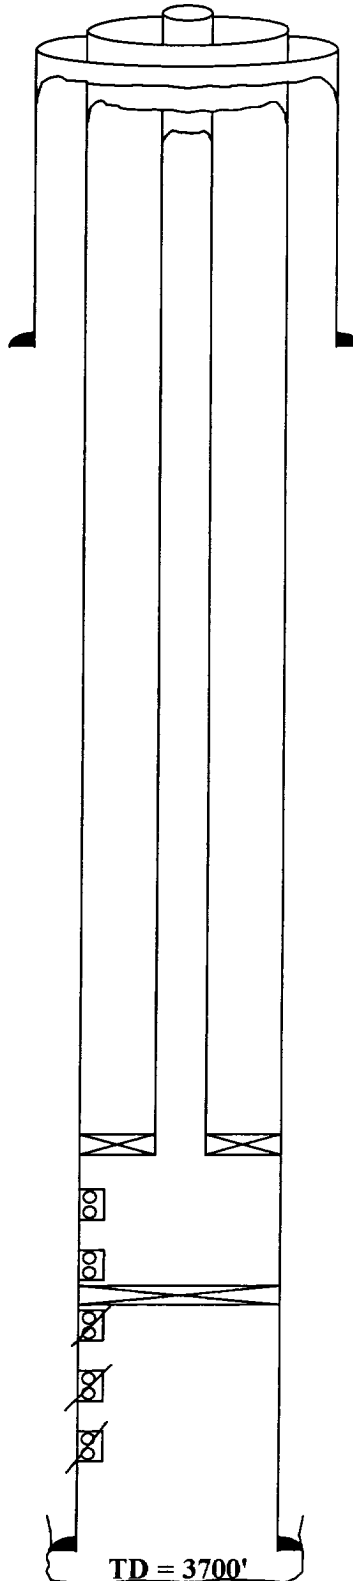

Pkr @ 3329'

Perfs:
3419-27, 3430-34, 3445-54'
3503-08, 3524-26, 3534-36'
3544-46, 3578-80, 3602-04' } Sqz'd 9/71
3602-04, 3621-23, 3640-42

Cmt Ret @ 3468'

TD = 3700'

GRUY PETROLEUM MANAGEMENT CO.

Langlie Mattix (Queen)
Spud 10/15/69

Langlie Mattix Queen Unit #15

API 30-025-21960

PROPOSED COMPLETION

Sherry Reid Carroll 6/21/02

KB: -
DF: -
GL: 3106'

1980' FNL & 1730' FWL
Sec 15, Unit Letter F
T-25-S, R-37-E
Lea County, New Mexico

Casing Strings:

8-5/8" (12-1/4" hole), 20#
@ 1025' w/ 700 sx cmt

5-1/2" (7-7/8" hole), 15.5#, J-55
@ 3700' w/ 860 sx cmt
TOC @ 1525' (temp survey)


Tubing String:

CIBP @ 3370' w/ 35' cmt

Cmt ret @ 3468'

Perfs:

3419-27, 3430-34, 3445-54'
3503-08, 3524-26, 3534-36'
3544-46, 3578-80, 3602-04'
3602-04, 3621-23, 3640-42' } Sqz'd 9/71

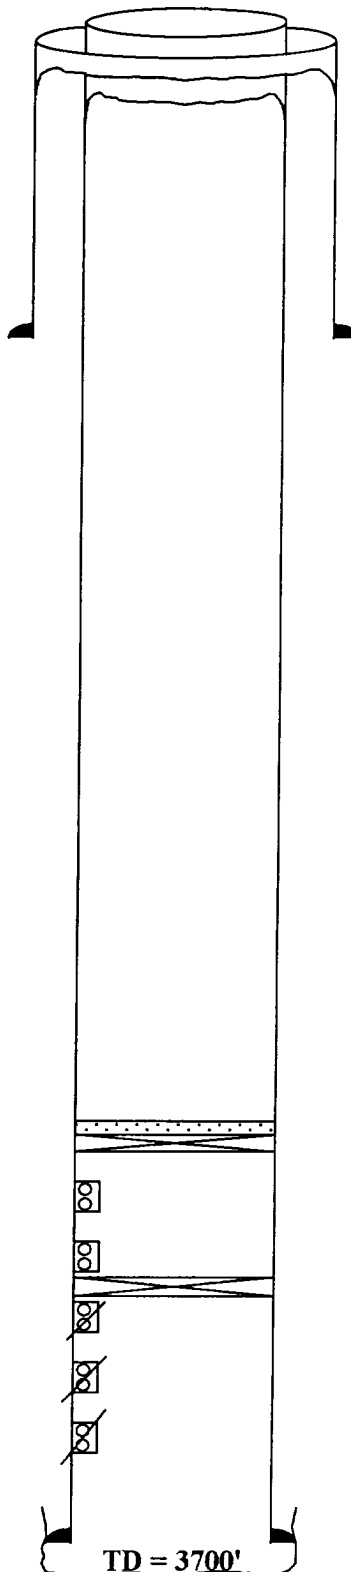

TD = 3700'