

N. M. OIL CONS. COMMISSION

P. O. BOX 1980

HOBBS, NEW MEXICO 88240

Form Approved.
Budget Bureau No. 42-R1424

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other

2. NAME OF OPERATOR
CONOCO INC.

3. ADDRESS OF OPERATOR
P. O. Box 460, Hobbs, N.M. 88240


4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980' FSL & 1980' FWL
AT TOP PROD. INTERVAL: ☒
AT TOTAL DEPTH: ☒

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☒
(other) New procedure

SUBSEQUENT REPORT OF:

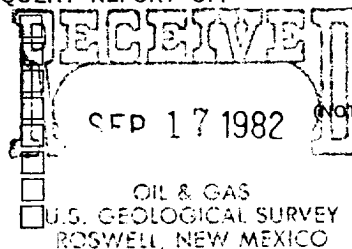

5. LEASE

LC-032581 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

NMFU

8. FARM OR LEASE NAME

Sholes B-19 Com.

9. WELL NO.

4

10. FIELD OR WILDCAT NAME

Undesignated Devonian Ellenburger

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 19, T-25S, R-37E

12. COUNTY OR PARISH

Lea

13. STATE

N.M.

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Set cmt. retainer at 8700'. Squeeze Strawn w/1005x class 'C' cmt. Spot 25' cmt. on top of retainer. Spot 50 5x class 'C' cmt. from 6600' to 6200'. Spot 50 5x class 'C' cmt from 4450' to 4130'. If free point found above 1500', rig down casing jacks. If free point below 1500', back off csg at joint above free point & POOH. If 7" csg removed, spot 50 5x class 'C' cmt from 100' below top of 7" csg to 100' above top of 7" csg. If csg left intact, spot 50 5x cmt plug from 2200' to 1880'. GIH w/2 3/8" tbg and spot 50 5x class 'C' neat cmt. from 316" (7") or 157" (95 1/8") to surface. Rig down. Erect PVA marker. Clean up location.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Wm. J. Dutton TITLE Administrative Supervisor DATE 9-15-82

APPROVED

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL IF ANY _____

SEP 22 1982

FOR

JAMES A. GILLHAM

DISTRICT SUPERVISOR *See Instructions on Reverse Side