

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C 103  
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO	30 025 32476
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B 2657
7. Lease Name or Unit Agreement Name	State A - 2
8. Well No.	5
9. Pool name or Wildcat	Justis Blinbry/Justis Tubb Drinkard

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> OTHER	
2. Name of Operator Conoco Inc.	
3. Address of Operator 10 Desta Dr. Ste 100W, Midland, Tx., 79705-4500	
4. Well Location Unit Letter O 990 Feet From The South Line and 2005 Feet From The East Line Section 2 Township 25S Range 37E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11 Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
OTHER <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	PLUG AND ABANDONMENT <input type="checkbox"/>
	OTHER Scale squeeze & run tubing <input checked="" type="checkbox"/>

12 Describe Proposed or Completed Operations (Clearly state all pertinent details and give pertinent dates including estimated date of starting any proposed work/SEE RULE 1103.)

9-12-97: Rigged up - SDON.

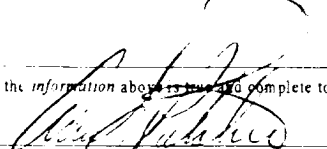
9-15-97: Hot oil rods & tubing. POOH w/rod & pump. kill well. tag for fill. TOOH. RIH w/bit & scrapper. tag @ 6147' - SDON.

9-16-97: Bled well down. POOH w/tbg laid down bit & scraper. picked up RBP & Pkr. RIH - set 6140'. set Pkr @ 5725'. performed chemical squeeze. unset Pkr. RIH w/tbg. unset RBP, pulled up hole w/RBP set @ 5725'. set Pkr @ 5000'. Performed chemical squeeze at top zone. SDON.

9-18-97: Bled well unset packer. RIH & latched onto RBP. POOH - killed well. Laid down RBP & Pkr. RIH w/notched collar to top of perfs. SDON


9-19-97 to 9-22-97: Ran in hole with tubing. SN @ 6027'. RIH w/rods & pump. tested 500#-good. check pump action. well on production.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Regulatory Agent DATE 10-24-97/11-5-97

TYPE OR PRINT NAME Ann E. Ritchie TELEPHONE NO. 915 684-6381

(this space for State Use)

APPROVED BY  TITLE DATE

CONDITIONS OF APPROVAL IF ANY