

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Con
P 1980
Hobbs NM 88241

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT --" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well: ☒ OIL WELL ☐ GAS WELL ☐ OTHER

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address and Telephone No. P.O. Box 2100, Denver Colorado 80201 (303)793-4851

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit Letter B : 330 Feet From The NORTH Line and 1650 Feet From The

EAST Line Section 35 Township 24-S Range 37-E

5. Lease Designation and Serial No.

NM 14218

6. If Indian, Alottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and Number

C. C. FRISTOE 'B' FEDERAL NCT-2

21

9. API Well No.

30-025-34010

10. Field and Pool, Exploratory Area

JUSTIS BLINEBRY / JUSTIS TUBB DRINKARD

11. County or Parish, State

LEA, NM

12. Check Appropriate Box(s) To Indicate Nature of Notice, Report, or Other Data

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION


- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ OTHER: COMPLETION

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. RUN CBL/GR/CCL. FOUND PBTD @ 6404'. TOC @ 1200'-1300'. PERF'D DRINKARD INTERVALS FROM 5780'-92, 5876'-5890', 6046'-6070', 6078'-6088', 6150'-6205'. 07-24-97.
2. ACIDIZED WELL W/6000 GAL 15% HCL NEFE ACID. 07-25-97.
3. DOWELL FRAC'D DRINKARD PERFS W/37,000 GAL OF 35# BORATE CROSSLINKED GEL, 88,000# 20/40 SAND TAILED IN W/20,000 OF 20/40 RESIN COATED SAND. 07-26-97.
4. MIRU SCHLUMBERGER. DUMP 2 SX SAND ON RBP. PERF'D THE BLINEBRY 5108'-48, 5170-98', 5224-50', 5300'-14, 5332'-38', 5462'-70', 5496'-5506', 5524'-32'. 07-27-97.
5. ACIDIZED THE BLINEBRY PERFS 5108'-5532' W/7000 GAL 15% HCL, NEFE ACID. PERFS BROKE DOWN @ 1961 PSI. 07-28-97.
6. FRAC'D THE BLINEBRY PERFS, 5108'-5532' W/35,400 GAL 35# BORATE GEL, 90,000 16/30 SAND, TAILED IN W/30,000# 16/30 RESIN COATED SAND. 07-29-97.
7. TIH W/2 3/8" MA, SN, 10 JTS 2 3/8" TBG, TA & SET MA @ 6190', SN @ 6144', TA @ 5066'. RN PM & RODS. 08-02-97.
8. PUT ON PUMP TEST. 08-03-97.
9. OPT: PM 98 BO, 293 BLW, 490 MCF FROM DRLG TO PUMPING. 08-08-97.

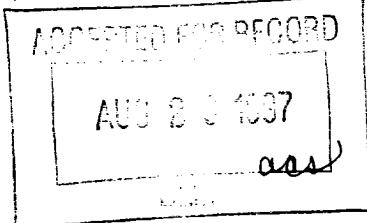

RECEIVED
1997 AUG 25 P 11: 26
BUREAU OF LAND MGMT
ROSWELL OFFICE

14. I hereby certify that the foregoing is true and correct

SIGNATURE C.P. Buchanan / SKH TITLE Eng. Assistant.

DATE 8/14/97

TYPE OR PRINT NAME Sheila D. Reed-High

(This space for Federal or State office use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY: TITLE DATE