

Site Diagram

Burnett, Gissler B 33 Battery
Eddy County, NM
Drafted By: Lance Crenshaw, 1-22-15

0 0.005 0.01 0.02 Miles

Legend

Misc_points

Types

- Electrical Box
- Power Pole
- Headers
- Injection
- Pumpjacks
- Tanks
- Valves
- Other
- sample_pts
- Source

Pipeline

Type


- Above Ground Line
- Buried Line

Spill

- <all other values>

Spill_Media

- Oil and Produced H2O
- Oil
- Other
- Produced Water

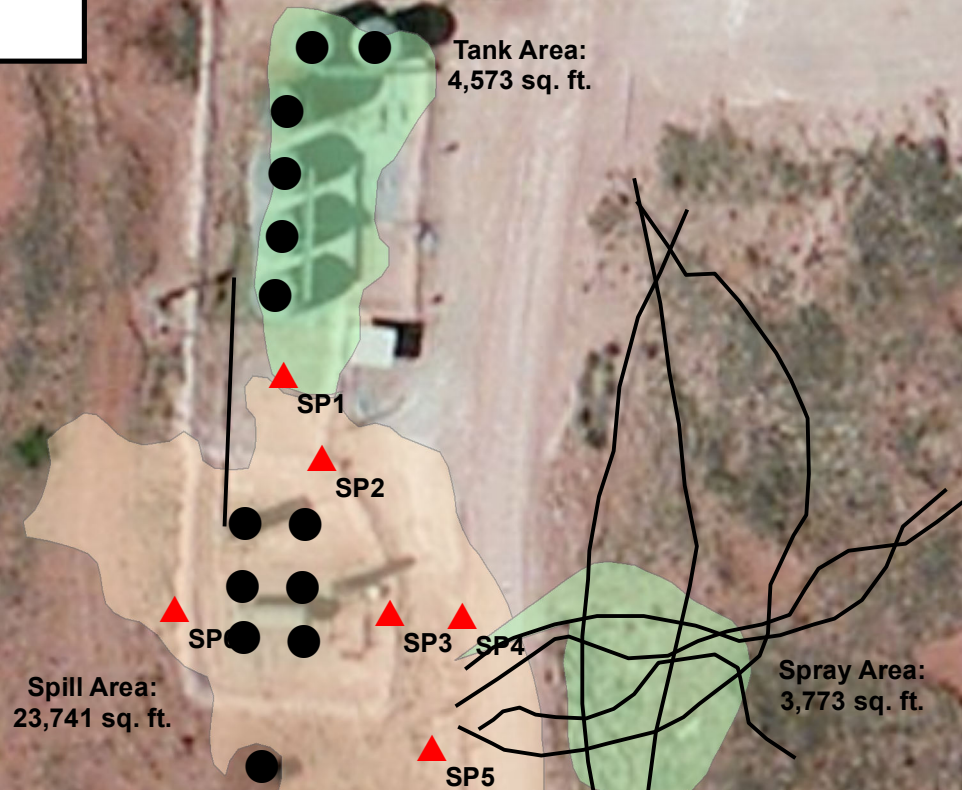

Lance Crenshaw
GIS Technician

Soil Remediation and Ground Water Remediation
Environmental Assessments
Regulatory Compliance



Environmental

DFS

Services

Office: 575-964-8394

Fax: 575-964-8396

Cell: 575-441-2359

Email: lcrenshaw@diversifiedfsi.com

Source: Esri, DigitalGlobe, GeoEye, IGN, swisstopo, and the GIS User Community

Diversified Environmental Services

Company Name: Burnett Oil And gas
Location Name: Gissler B 33 Battery

SP Date: 1/21/2015
Rel Date: _____

SP1	CHL	TPH	SP2	CHL	TPH	SP3	CHL	TPH	SP4	CHL	TPH	SP5	CHL	TPH
surf	18869		surf	5773		surf	8722		surf	14045		surf	8872	
1'	5873		1'	5773		1'	1699		1'	3548		1'	5755	
2'	3873		2'	6997		2'	1874		2'	1449		2'	7872	
3'	6922		3'	4973		3'	1299		3'	799		3'	874	
4'	7472		4'	5322		4'	1324		4'	624		4'	1124	
5'	4323		5'	4473		5'	1949					5'	3273	
6'	3548		6'	3873		6'	1974					6'	3548	
7'	3224		7'	2474		7'	1974					7'	3974	
8'	3448		8'	2349		8'	4998					8'	3873	
9'	3548		9'	1949		9'	3573					9'	5248	
10'	4973		10'	2474		10'	974					10'	3323	
11'	3113		11'	1449		11'	3024					11'	2474	
12'	3074		12'	1399		12'	1124					12'	1948	
AUGER REFUSEL			13'	1224		13'	3523					13'	1374	
			14'	1124		14'	3473					14'	1574	
			15'	1024		15'	3124					15'	1199	
			16'	1024		16'	2474					16'	1024	

	Lab Confirmation Sample
	Field Sampling
	Needs Delineation and confirmation samples

Diversified Environmental Services

SP6	CHL	TPH	SP7	CHL	TPH	SP8	CHL	TPH	SP9	CHL	TPH	SP10	CHL	TPH
surf	9696													
1'	6522													
2'	4448													
3'	4373													
4'	4048													
5'	5273													
6'	5123													
7'	4973													
8'	4048													
9'	3773													
10'	3049													
11'	2474													
12'	1999													
13'	2749													
14'	3024													
15'	1999													
16'	2124													

	Lab Confirmation Sample
	Field Sampling
	Needs Delineation and confirmation samples

Diversified Environmental Services

[illegible]

	Lab Confirmation Sample
	Field Sampling
	Needs Delineation and confirmation samples

Diversified Environmental Services

[illegible]

	Lab Confirmation Sample
	Field Sampling
	Needs Delineation and confirmation samples