

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-40372
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Lone Tree Draw 13 State Com
8. Well Number 2H
9. OGRID Number 6137
10. Pool name or Wildcat Fenton; Delaware, Northwest
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3314.3' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Devon Energy Production Company, L.P.

3. Address of Operator
333 W. Sheridan, Oklahoma City, OK 73102

4. Well Location
Unit Letter D : 150 feet from the North line and 750 feet from the West line
Section 13 Township 21S Range 27E NMPM Eddy County

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐


OTHER: ☐

OTHER: Completion Report ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

11/1/2012 - 11/17/2012

MIRU. RIH w/logging tools. Tested Csg to 1100 psi. OK. Ran CBL logs. Found TOC @ 1380'. Perforate Delaware (Brushy Canyon) 5133 - 9360'; 324 holes. Frac'd 5133 - 9360' in 9 stages. Frac Totals: 18000 gals 15% HCL acid, 1,276,484# 20/40 white sand, 370,490# 16/30 Siber Prop. RIH w/2 7/8" tubing. EOT @ 4457'. Turn well over to production.

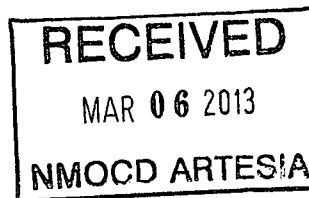

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE: Patti Riechers TITLE: Regulatory Specialist DATE: 03/01/2013

Type or print name: Patti Riechers E-mail address: patti.riechers@dvn.com PHONE: 405-228-4248

For State Use Only
APPROVED BY: S. R. Dade TITLE: Dist. P. Supervisor DATE: 3/7/13
Conditions of Approval (if any):