


District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 S. First St., Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

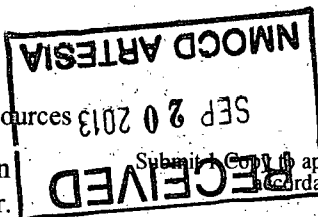

Form C-141  
Revised August 8, 2011

Release Notification and Corrective Action

Operator: ☐ Initial Report ☒ Final Report

Name of Company	Linn Operating	Contact	Joë Hernandez
Address	2130 W. Bender Blvd, Hobbs, NM 88240	Telephone No.	575-738-1739
Facility Name	J.L. Keel B #91	Facility Type	Oil
Surface Owner	Federal	Mineral Owner	Federal
		API No.	30-015-28442

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
G	8	17S	31E	2664	FSL	2562	FEL	Eddy

Latitude 32.84917° N Longitude 103.89088° W

NATURE OF RELEASE

Type of Release	Produced Water/Oil	Volume of Release	10/5	Volume Recovered	0/0
Source of Release	Poly Pipeline	Date and Hour of Occurrence	8/24/2012 11 am	Date and Hour of Discovery	8/24/2012 11:30 am
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	M. Bratcher - NMOCD Terry Gregston - BLM		
By Whom?	Gary Wink	Date and Hour	8/29/2012 8am		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			

If a Watercourse was Impacted, Describe Fully.\*

Describe Cause of Problem and Remedial Action Taken.\*

While attempting to flush flow, line pressured up to 250 lbs. and the transition at well head ruptured. The pressurized fluid in the line sprayed out and onto the pad. A vacuum truck arrived and picked up less than 1 bbl of oil.

Describe Area Affected and Cleanup Action Taken.\*

The spill affected approximately 1600 square feet of the well pad and 1800 square feet of pasture area to the southwest. The spill was delineated by Diversified Field Services, Inc. Impacted soils were removed to a NMOCD approved disposal facility. Confirmation samples were submitted to a commercial lab for analyses. Backfill of the excavation was approved by the NMOCD and BLM. The excavation was backfilled and the site was contoured to the surrounding landscape. The area was seeded with Lesser Prairie Chicken seed mix.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	OIL CONSERVATION DIVISION	
Printed Name: Brian Wall	Approved by Environmental Specialist:	
Title: Construction Foreman	Approval Date: NOV 05 2013	Expiration Date: N/A
E-mail Address: bwall@linenergy.com	Conditions of Approval: N/A	Attached <input type="checkbox"/>
Date: Phone: (432)363-9372		

\* Attach Additional Sheets If Necessary

2RP-1294